


2 YEARS Warranty
(Power Source)

UNI-MIG
WELDING



OPERATING MANUAL KUMJR200AC/DC

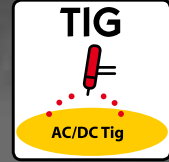

Please read and understand this instruction manual carefully before the installation and operation of this equipment.

Thank you for your purchase of your UNI-MIG welding machine.

We are proud of our range of welding equipment that has a proven track record of innovation, performance and reliability.

Our product range represents the latest developments in Inverter technology that have been implemented by our professional team of highly skilled engineers. The expertise gained from our long history of sales has proven to be invaluable to the evolution and future development of our equipment range. This experience gives us the inside knowledge on what the arc characteristics, performance and interface between man and machine should be.

We employ an expert team of professional sales, marketing and technical personnel that provide us with market trends, market feedback and customer comments and requirements. Secondly they provide a customer support service that is second to none, thus ensuring our customers have confidence that they will be well satisfied both now and in the future.

UNI-MIG welders are manufactured to comply with - AS/NZ60974.1 2006 - AS60974-6:2006

WARRANTY

- 2 Years from date of purchase.
- Welding Guns Of Australia PTY LTD Ltd warranties all goods as specified by the manufacturer of those goods.
- This Warranty does not cover freight or goods that have been interfered with.
- All goods in question must be repaired by an authorised repair agent as appointed by this company.
- Warranty does not cover abuse, mis-use, accident, theft, general wear and tear.
- New product will not be supplied unless Welding Guns Of Australia PTY LTD has inspected product returned for warranty and agree's to replace product.
- Product will only be replaced if repair is not possible
- Please view full Warranty term and conditions supplied with machine or at www.unimig.com.au/warranty.asp or at the back of this manual.

CONTENTS	PAGE
Warranty	2
Safety - Cautions	4-6
Technical Data, Product Information	7
Machine Layout & Descriptions	8
Front Panel Selector Switch Function Descriptions	9
Front Panel Control Dial Function Descriptions	10-11
Machine Installation & Operation	13
Installation & Operation for MMA (Stick) Welding	14-15
MMA (Stick) Welding	16-17
Installation & Operation for DC TIG Welding	18-19
DC TIG Welding, DC Pulse TIG Welding	20-22
TIG Welding Fusion and Filler Wire Technique	23
Installation & Operation for AC TIG Welding	24-25
AC TIG Welding, AC Pulse TIG Welding	26-28
Remote Controls - Installation and Operation	29
Tungsten Electrode Selection & Preparation	30-32
Trouble Shooting Guide - MMA (Stick) Welding	33
Trouble Shooting Guide - TIG Welding	34-35
TIG Torch Parts Breakdown	36-37
Machine Spare Parts Identification	38-39

SAFETY

Welding and cutting equipment can be dangerous to both the operator and people in or near the surrounding working area, if the equipment is not correctly operated. Equipment must only be used under the strict and comprehensive observance of all relevant safety regulations. Read and understand this instruction manual carefully before the installation and operation of this equipment.

Machine Operating Safety

- Do not switch the function modes while the machine is operating. Switching of the function modes during welding can damage the machine. Damage caused in this manner will not be covered under warranty.
- Disconnect the electrode-holder cable from the machine before switching on the machine, to avoid arcing should the electrode be in contact with the work piece.
- Operators should be trained and or qualified.




Electric shock: It can kill. Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and internal machine circuits are also live when power is on. In Mig/Mag welding, the wire, drive rollers, wire feed housing, and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is dangerous.

- Connect the primary input cable according to Australian and New Zealand standards and regulations.
- Avoid all contact with live electrical parts of the welding circuit, electrodes and wires with bare hands. The operator must wear dry welding gloves while he/she performs the welding task.
- The operator should keep the work piece insulated from himself/herself.
- Keep cords dry, free of oil and grease, and protected from hot metal and sparks.
- Frequently inspect input power cable for wear and tear, replace the cable immediately if damaged, bare wiring is dangerous and can kill.
- Do not use damaged, under sized, or badly joined cables.
- Do not drape cables over your body.



Fumes and gases are dangerous. Smoke and gas generated whilst welding or cutting can be harmful to people's health. Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health.

- Do not breathe the smoke and gas generated whilst welding or cutting, keep your head out of the fumes
- Keep the working area well ventilated, use fume extraction or ventilation to remove welding fumes and gases.
- In confined or heavy fume environments always wear an approved air-supplied respirator. Welding fumes and gases can displace air and lower the oxygen level causing injury or death. Be sure the breathing air is safe.
- Do not weld in locations near de-greasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapours to form highly toxic and irritating gases.
- Materials such as galvanized, lead, or cadmium plated steel, containing elements that can give off toxic fumes when welded. Do not weld these materials unless the area is very well ventilated, and or wearing an air supplied respirator.

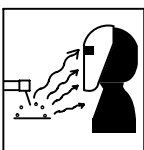

Arc rays: harmful to people's eyes and skin. Arc rays from the welding process produce intense visible and invisible ultraviolet and infrared rays that can burn eyes and skin.

- Always wear a welding helmet with correct shade of filter lens and suitable protective clothing including welding gloves whilst the welding operation is performed.
- Measures should be taken to protect people in or near the surrounding working area. Use protective screens or barriers to protect others from flash, glare and sparks; warn others not to watch the arc.



Fire hazard. Welding on closed containers, such as tanks, drums, or pipes, can cause them to explode. Flying sparks from the welding arc, hot work piece, and hot equipment can cause fires and burns. Accidental contact of electrode to metal objects can cause sparks, explosion, overheating, or fire. Check and be sure the area is safe before doing any welding.

- The welding sparks may cause fire, therefore remove any flammable materials away from the working area, at least 12m from the welding arc. Cover flammable materials and containers with approved covers if unable to be moved from the welding area.
- Do not weld on closed containers such as tanks, drums, or pipes, unless they are properly prepared according to the required Safety Standards to insure that flammable or toxic vapors and substances are totally removed, these can cause an explosion even though the vessel has been “cleaned”. Vent hollow castings or containers before heating, cutting or welding. They may explode.
- Do not weld where the atmosphere may contain flammable dust, gas, or liquid vapours (such as petrol)
- Have a fire extinguisher nearby and know how to use it. Be alert that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Be aware that welding on a ceiling, floor, bulkhead, or partition can cause fire on the hidden side.




Gas Cylinders. Shielding gas cylinders contain gas under high pressure. If damaged, a cylinder can explode. Because gas cylinders are normally part of the welding process, be sure to treat them carefully. CYLINDERS can explode if damaged.

- Protect gas cylinders from excessive heat, mechanical shocks, physical damage, slag, open flames, sparks, and arcs.
- Insure cylinders are held secure and upright to prevent tipping or falling over.
- Never allow the welding electrode or earth clamp to touch the gas cylinder, do not drape welding cables over the cylinder.
- Never weld on a pressurised gas cylinder, it will explode and kill you.
- Open the cylinder valve slowly and turn your face away from the cylinder outlet valve and gas regulator.



Gas build up. The build up of gas can causes a toxic environment, deplete the oxygen content in the air resulting in death or injury. Many gases use in welding are invisible and odourless.

- Shut off shielding gas supply when not in use.
- Always ventilate confined spaces or use approved air-supplied respirator.

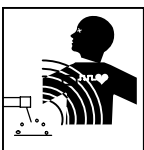

Electronic magnetic fields. MAGNETIC FIELDS can affect Implanted Medical Devices.

- Wearers of Pacemakers and other Implanted Medical Devices should keep away.
- Implanted Medical Device wearers should consult their doctor and the device manufacturer before going near any electric welding, cutting or heating operation.



Noise can damage hearing. Noise from some processes or equipment can damage hearing. Wear approved ear protection if noise level is high.



Hot parts. Items being welded generate and hold high heat and can cause severe burns. Do not touch hot parts with bare hands. Allow a cooling period before working on the welding gun. Use insulated welding gloves and clothing to handle hot parts and prevent burns.

CAUTION

1. Working Environment.

- 1.1 The environment in which this welding equipment is installed must be free of grinding dust, corrosive chemicals, flammable gas or materials etc, and at no more than maximum of 80% humidity.
- 1.2 When using the machine outdoors protect the machine from direct sun light, rain water and snow etc; the temperature of working environment should be maintained within -10°C to +40°C.
- 1.3 Keep this equipment 30cm distant from the wall.
- 1.4 Ensure the working environment is well ventilated.

2. Safety Tips.

2.1 Ventilation

This equipment is small-sized, compact in structure, and of excellent performance in amperage output. The fan is used to dissipate heat generated by this equipment during the welding operation.

Important: Maintain good ventilation of the louvers of this equipment. The minimum distance between this equipment and any other objects in or near the working area should be 30 cm. Good ventilation is of critical importance for the normal performance and service life of this equipment.

2.2 Thermal Overload protection.

Should the machine be used to an excessive level, or in high temperature environment, poorly ventilated area or if the fan malfunctions the Thermal Overload Switch will be activated and the machine will cease to operate. Under this circumstance, leave the machine switched on to keep the built-in fan working to bring down the temperature inside the equipment. The machine will be ready for use again when the internal temperature reaches safe level.

2.3 Over-Voltage Supply

Regarding the power supply voltage range of the machine, please refer to “Main parameter” table.

This equipment is of automatic voltage compensation, which enables the maintaining of the voltage range within the given range. In case that the voltage of input power supply amperage exceeds the stipulated value, it is possible to cause damage to the components of this equipment. Please ensure your primary power supply is correct.

- 2.4 Do not come into contact with the output terminals while the machine is in operation. An electric shock may possibly occur.

MAINTENANCE

Exposure to extremely dusty, damp, or corrosive air is damaging to the welding machine. In order to prevent any possible failure or fault of this welding equipment, clean the dust at regular intervals with clean and dry compressed air of required pressure.

Please note that: lack of maintenance can result in the cancellation of the guarantee; the guarantee of this welding equipment will be void if the machine has been modified, attempt to take apart the machine or open the factory-made sealing of the machine without the consent of an authorized representative of the manufacturer.

TROUBLE SHOOTING

Caution: Only qualified technicians are authorized to undertake the repair of this welding equipment. For your safety and to avoid Electrical Shock, please observe all safety notes and precautions detailed in this manual.

Note:

Minimum Motor Generator Power Suggested:- 10KVA



TIG 200Amp AC/DC Welding Machine Square Wave, Pulse, Remote Control

Welds: Aluminium, Zinc Alloy, Carbon Steels, Alloy Steels, Stainless, Cast Iron, Bronze, Copper

Features

- Latest IGBT Inverter Technology
- AC/DC Tig (AC/DC tungsten inert gas welding)
- HF Tig Function (provides easy arc start, prevents tungsten damage)
- 2/4T Trigger Function
- AC Square Wave with Adjustable AC Balance Control
- Adjustable Pulse Control - 0.5 - 300Hz
- Adjustable Base Current 10-90%
- Adjustable Down Slope 0-10 sec
- Adjustable Post Gas 0-10 sec
- MMA (stick electrode)
- Hot start (improves electrode starting)
- Arc Force (stabilises the arc with difficult to use electrodes)
- Remote Amperage Control - Optional



Technical Data

Power Supply / Phases (V-Ph)	240V - 1 ±15%
Rated Input Power (KVA)	5.8
ieff (Amps)	14.6 (TIG)
Rated Input Current (A)	24
Rated Output	20-170A/26.8V MMA 10-200A/17.4V TIG
No-Load Voltage (V)	56
Duty Cycle @ 40°C as per AS/NZ60974	20%@170Amps MMA 20%@200Amps TIG
Efficiency (%)	85
Power Factor	0.93
Protection Class	IP21S
Insulation Class	F
Size (mm)	510x330x360
Weight (kg)	30Kg
Warranty	2 years on power source



UTJRFC
Remote Foot Control Option



SRMS-10
Amperage Control for torch



UTJRTROLLEY
Trolley Option

Overview

The KUMJR200AC/DC is a 240V square wave AC/DC TIG inverter welder incorporating full TIG functionality including AC balance control, pre gas, down slope, post gas, variable pulse parameters, HF start with 2/4T trigger control. The HF arc start provides easy arc ignition leaving no tungsten inclusion and no contamination of the tungsten electrode. The Down Slope and Post Gas combined with the 2/4T trigger function gives you control of the welder allowing you to control the start and finish of the weld process at a professional level. The addition of a fully adjustable pulse function of frequency, base current and pulse width gives you the added capability to better control heat input into the work, control penetration & control distortion. AC balance control lets you set the AC TIG arc for cleaning of the oxide layer on aluminium and adjustment for a deeper penetrating weld. Combining the functions of the KUMJR200AC/DC ensures comprehensive control of the welding parameters when welding both AC and DC weldable materials giving you the ability to produce professional Tig welds. The DC MMA welding capability delivers a smooth and stable arc allowing easy welding with electrodes obtaining high quality welds including cast Iron, stainless and low hydrogen. Addition of the optional Foot Control provides variable amperage adjustment during welding. The UNI-MIG KUMJR200AC/DC has set the benchmark for 240V single phase AC/DC welders and made it ideal for multiple applications; aluminium & stainless steel fabrication, light industrial use, repair and maintenance applications.

Robust & reliable, built to our specification and manufactured in compliance to AS/NZ60974.1

Product Code: KUMJR200AC/DC

Standard option includes: KUMJR200AC/DC Machine, SR26 Tig Torch x 4m, Earth Lead & Arc Lead 25mm x 4m, Argon Regulator, 2M Gas Hose with fittings

Front Machine Layout Description





Rear Machine Layout Description




Selector Switch Function Descriptions



- 

1 ON/OFF: This switch powers the machine up when switched to the on position and powers the machine off when switched to the off position.
- 


2 Remote: Provides selection of the remote output current (amps) control function. Selecting the ON position allows use of the remote current (amperage) controls. Selecting the OFF position allows current (amperage) control from the front panel Peak current control.
- 


3 2T/4T: Provides control over the arc ignition, weld cycle and finishing of the weld using the torch trigger switch.


 

2T Selection provides 2 times function of the torch switch

 - (1) Pressing the torch switch gives arc ignition and initializes the welding current
 - (2) Releasing the torch switch introduces down slope time to minimum current level and then terminates the welding current and introduces the post flow gas

4T Selection provides 4 times function of the torch switch

 - (1) Pressing the torch switch gives arc ignition and initializes the welding current
 - (2) Releasing the torch switch continues the welding operation.
 - (3) Pressing the torch switch introduces down slope and current falls to minimum current
 - (4) Releasing the torch switch terminates the welding operation and introduces the post flow gas.
- 

4 AC/DC: Provides selection of AC or DC Current. Selecting the **AC** position provides for AC welding current output. Selecting the **DC** position provides for DC welding current output.
- 

5 Pulse Selector: Provides selection of Pulse welding mode. Selecting the  position places the machine in Pulse welding mode. Selecting the  position places the machine in standard (non Pulse) welding mode.
- 

6 TIG/MMA: Provides selection of TIG or MMA (Stick) welding modes. Selecting the **TIG** position provides for TIG welding function. Selecting the **MMA** position provides for Manual Metal Arc (Stick) welding function.



A Gas Pre Flow: Provides a pre-flow of gas to purge tig torch gas line prior to the initialisation of the arc. Helps arc ignition and prevents porosity in the weld start. Adjustment is 0-1sec.



B Peak Current: Provides adjustment and control of the main welding current. Adjustment range 10-200 Amps.



C Base Current: Provides adjustment and control of the base welding current during pulse welding. Represents a percentage of the Peak welding current, for example Peak current set at 100 amps - Base Current set at 20% (20 amps) it means the output current (amps) during the pulse cycle will go from 100 amps down to 20 amps during each pulse cycle. Adjustment range 20 - 90%.





D Down Slope: Provides adjustment of the down slope time at the end of the welding cycle. At the end of the weld cycle the welding current will reduce down gradually over the time set at the dial until it stops. This prevents craters and pin holes forming at the end of the weld. Adjustment is 0-10sec.
Note: When using the remote foot control set the dial to "0".





E Arc Force: Provides adjustment of the short circuit current during stick (MMA)welding. Arc force control helps prevent the electrode sticking to the work by sensing a drop in arc voltage and compensates by increasing the arc voltage. The higher the dial is set the more forceful and digging the arc will be, the lower it is set the more soft and buttery the arc characteristic will be.



F  **Pulse Frequency:** Provides adjustment and setting of the pulse frequency when the machine is set in Pulse mode. It adjust the amount of times per second (Hz) the output current switches from the Peak current setting to Base current setting. Adjustment is 0.5-300Hz.

G  **Pulse Width:** Provides adjustment and setting of the on time for the Peak current during a pulse cycle.
Example: Peak current set at 100 amps - Base Current set at 20% (20 amps) (It means the output current (amps) will go from 100 amps to 20 amps during each pulse cycle.) Set the Pulse Width control at for example 60% and the output current (amps) will be on for 60% of the time of the pulse cycle at the Peak current and 40% of the time at the base current.
Adjustment is 10% – 90%.

H  **AC Balance:**
To understand how balance control works, you first need to understand why aluminium and magnesium require an AC welding output. These materials have an insulating surface oxide layer that melts at a higher temperature than the base metal and makes it difficult to weld the base metal if the oxides are not removed. AC welding current is ideal because the nature of the AC output assists in breaking the surface oxide layer. The AC Balance dial is for adjusting the current flow time between positive (+) and negative (-). When set at the middle the proportion is 50%. When set at the maximum it is 80% (+) and at the minimum it is 10% (+). Adjusted in a clockwise direction, the time that the tungsten is at (+) is longer and this promotes an aggressive cleaning action of the oxide film from the material surface. Care should be taken as too much time at the tungsten being (+) can drive too much energy to the tungsten causing it to overheat. When the dial is set lower (below 50%) it tightens the arc and provides a deeper penetrating arc characteristic.

I  **Gas Post Flow:** Provides adjustment and control of an after flow of gas when the welding arc is extinguished. Post flow gas prevents contamination of the weld pool during its cool down period from molten state to solid at the weld finish also keeping the tungsten electrode protected from oxidising atmosphere during the cool down cycle. The Gas Post flow time will depend of the tungsten size and welding current that is being used, when the Gas Post Flow is set correctly the tungsten electrode will have a clean shiny finish.
Adjustment 0-10sec.



Please install the machine strictly according to the following steps.
The protection class of this machine is IP21S, so avoid using it in rain.

Connection of Input Cables

Primary input cable is supplied with this welding equipment. Connect the primary input cable with power supply of required input voltage. Refer to data plate on machine for Input voltage, IMAX and IEFF.

ATTENTION! - CHECK FOR GAS LEAKS

At initial set up and at regular intervals we recommend to check for gas leakage

Recommended procedure is as follows:

1. Connect the regulator and gas hose assembly and tighten all connectors and clamps.
2. Slowly open the cylinder valve.
3. Set the flow rate on the regulator to approximately 8-10 l/min.
4. Close the cylinder valve and pay attention to the needle indicator of the contents pressure gauge on the regulator, if the needle drops away towards zero there is a gas leak.
Sometimes a gas leak can be slow and to identify it will require leaving the gas pressure in the regulator and line for an extended time period. In this situation it is recommended to open the cylinder valve, set the flow rate to 8-10 l/min, close the cylinder valve and check after a minimum of 15 minutes.
5. If there is a gas loss then check all connectors and clamps for leakage by brushing or spraying with soapy water, bubbles will appear at the leakage point.
6. Tighten clamps or fittings to eliminate gas leakage.

IMPORTANT! - We strongly recommend that you check for gas leakage prior to operation of your machine. We recommend that you close the cylinder valve when the machine is not in use.

Welding Guns Of Australia PTY LTD, authorised representatives or agents of Welding Guns Of Australia PTY LTD will not be liable or responsible for the loss of any gas.



Installation set up for MMA (Stick) Welding with KUMJR200AC/DC

(1) Turn the power source on and select the **MMA** function with the Tig/MMA selector switch.

(2) Connection of Output Cables

Two sockets are available on this welding machine. For MMA welding the electrode holder is shown be connected to the positive socket, while the earth lead (work piece) is connected to the negative socket, this is known as DC+ polarity. However various electrodes require a different polarity for optimum results and careful attention should be paid to the polarity, refer to the electrode manufacturers information for the correct polarity.

DC+ Electrode connected to (+) output socket.

DC- Electrode connected to (-) output socket.



(1) Set Tig/MMA selector switch to MMA

(3) Connect Earth Lead the (-) terminal

(2) Connect the Electrode lead to (+) terminal

continued set up and operation for MMA (Stick) Welding



- (3) Set the welding current relevant to the electrode type and size being used as recommended by the electrode manufacturer
- (4) Place the electrode into the electrode holder and clamp tight
- (5) Strike the electrode against the workpiece to create an arc and hold the electrode steady to maintain the arc
- (6) Hold the electrode slightly above the work piece to maintain the arc while travelling at an even speed to create an even weld deposition
- (7) To finish the weld, break the arc by quickly snapping the electrode away from the work piece.
- (8) Wait for the weld to cool and carefully chip away the slag to reveal the weld metal underneath



3) Set the welding current using the amperage control dial



(4) Place the electrode into the electrode holder and clamp tight.




(5) Strike the electrode against the workpiece to create an arc and hold the electrode steady to maintain the arc



(6) Hold the electrode slightly above the work maintaining the arc while travelling at an even speed.





(7) To finish the weld, break the arc by quickly snapping the electrode away from the work piece.

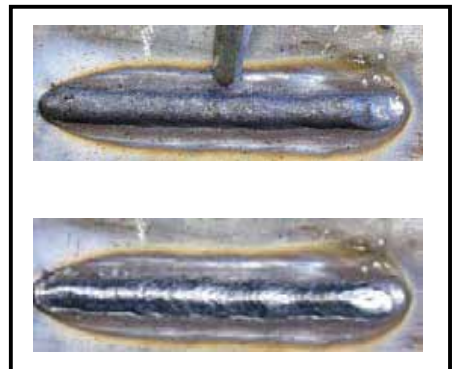


(8) Wait for the weld to cool and carefully chip away the slag to reveal the weld metal below.

MMA (Manual Metal Arc) Welding General Description

One of the most common types of arc welding is manual metal arc welding (MMA) or stick welding. An electric current is used to strike an arc between the base material and a consumable electrode rod or 'stick'. The electrode rod is made of a material that is compatible with the base material being welded and is covered with a flux that gives off gaseous vapours that serve as a shielding gas and providing a layer of slag, both of which protect the weld area from atmospheric contamination. The electrode core itself acts as filler material the residue from the flux that forms a slag covering over the weld metal must be chipped away after welding.

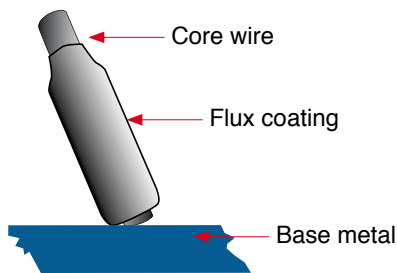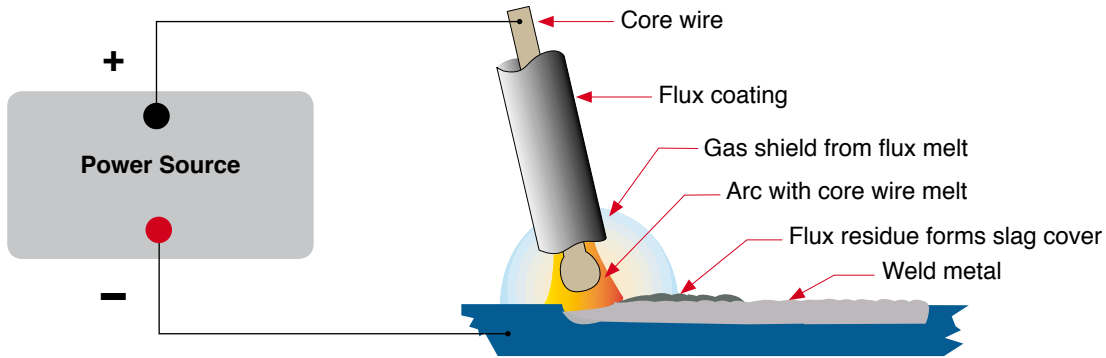

- The arc is initiated by momentarily touching the electrode to the base metal.
- The heat of the arc melts the surface of the base metal to form a molten pool at the end of the electrode.
- The melted electrode metal is transferred across the arc into the molten pool and becomes the deposited weld metal.
- The deposit is covered and protected by a slag which comes from the electrode coating.
- The arc and the immediate area are enveloped by an atmosphere of protective gas

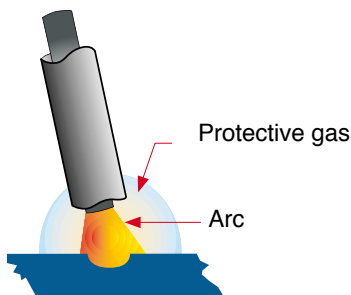


Manual metal arc (stick) electrodes have a solid metal wire core and a flux coating. These electrodes are identified by the wire diameter and by a series of letters and numbers. The letters and numbers identify the metal alloy and the intended use of the electrode.

The **Metal Wire Core** works as conductor of the current that maintains the arc. The core wire melts and is deposited into the welding pool.

The covering on a shielded metal arc welding electrode is called **Flux**. The flux on the electrode performs many different functions. These include:

- producing a protective gas around the weld area
- providing fluxing elements and deoxidizers
- creating a protective slag coating over the weld as it cools
- establishing arc characteristics
- adding alloying elements.

Covered electrodes serve many purposes in addition to adding filler metal to the molten pool. These additional functions are provided mainly by the covering on the electrode.

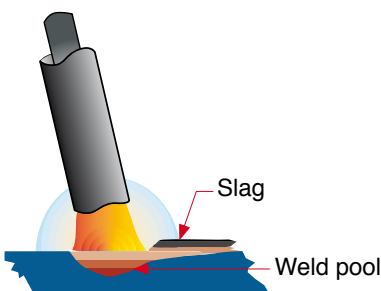

MMA (Stick) Welding Fundamentals

Electrode Selection

As a general rule, the selection of an electrode is straight forward, in that it is only a matter of selecting an electrode of similar composition to the parent metal. However, for some metals there is a choice of several electrodes, each of which has particular properties to suit specific classes of work. It is recommended to consult your welding supplier for the correct selection of electrode.

Electrode Size

Average Thickness of Material	Maximum Recommended Electrode Diameter
1.0 - 2.0mm	2.5mm
2.0 - 5.0mm	3.2mm
5.0 - 8.0mm	4.0mm
8.0 - > mm	5.0mm

The size of the electrode generally depends on the thickness of the section being welded, and the thicker the section the larger the electrode required. The table gives the maximum size of electrodes that maybe used for various thicknesses of section based on using a general purpose type 6013 electrode.

Welding Current (Amperage)

Electrode Size ø mm	Current Range (Amps)
2.5mm	60 - 100
3.2mm	100 - 130
4.0mm	130 - 165
5.0mm	165 - 260

Correct current selection for a particular job is an important factor in arc welding. With the current set too low, difficulty is experienced in striking and maintaining a stable arc. The electrode tends to stick to the work, penetration is poor and beads with a distinct rounded profile will be deposited. Too high current is accompanied by overheating of the electrode resulting undercut and burning through of the base metal and producing

excessive spatter. Normal current for a particular job may be considered as the maximum, which can be used without burning through the work, over-heating the electrode or producing a rough spattered surface. The table shows current ranges generally recommended for a general purpose type 6013 electrode.

Arc Length

To strike the arc, the electrode should be gently scraped on the work until the arc is established. There is a simple rule for the proper arc length; it should be the shortest arc that gives a good surface to the weld. An arc too long reduces penetration, produces spatter and gives a rough surface finish to the weld. An excessively short arc will cause sticking of the electrode and result in poor quality welds. General rule of thumb for down hand welding is to have an arc length no greater than the diameter of the core wire.

Electrode Angle

The angle that the electrode makes with the work is important to ensure a smooth, even transfer of metal. When welding in down hand, fillet, horizontal or overhead the angle of the electrode is generally between 5 and 15 degrees towards the direction of travel. When vertical up welding the angle of the electrode should be between 80 and 90 degrees to the work piece.

Travel Speed

The electrode should be moved along in the direction of the joint being welded at a speed that will give the size of run required. At the same time, the electrode is fed downwards to keep the correct arc length at all times. Excessive travel speeds lead to poor fusion, lack of penetration etc, while too slow a rate of travel will frequently lead to arc instability, slag inclusions and poor mechanical properties.


Material and Joint Preparation

The material to be welded should be clean and free of any moisture, paint, oil, grease, mill scale, rust or any other material that will hinder the arc and contaminate the weld material. Joint preparation will depend on the method used include sawing, punching, shearing, machining, flame cutting and others. In all cases edges should be clean and free of any contaminates. The type of joint will be determined by the chosen application.



Installation set up for DC TIG Welding with KUMJR200AC/DC

- (1) Turn on the machine using the **ON/OFF** switch
- (2) Select the **TIG** function with the **TIG/MMA** selector switch.
- (3) Select **DC** using the **AC/DC** selector switch.
- (4) Connect the **Tig Torch** connector to the **negative terminal** and tighten it.
- (5) Connect the **Earth Cable** connector into the **positive terminal** and tighten it.
- (6) Connect the torch switch remote lead into the torch remote socket
- (4) Insert the torch gas connector into the quick lock gas receptacle.
- (4) Connect gas line to Gas Regulator and connect the gas regulator to the Gas Cylinder.

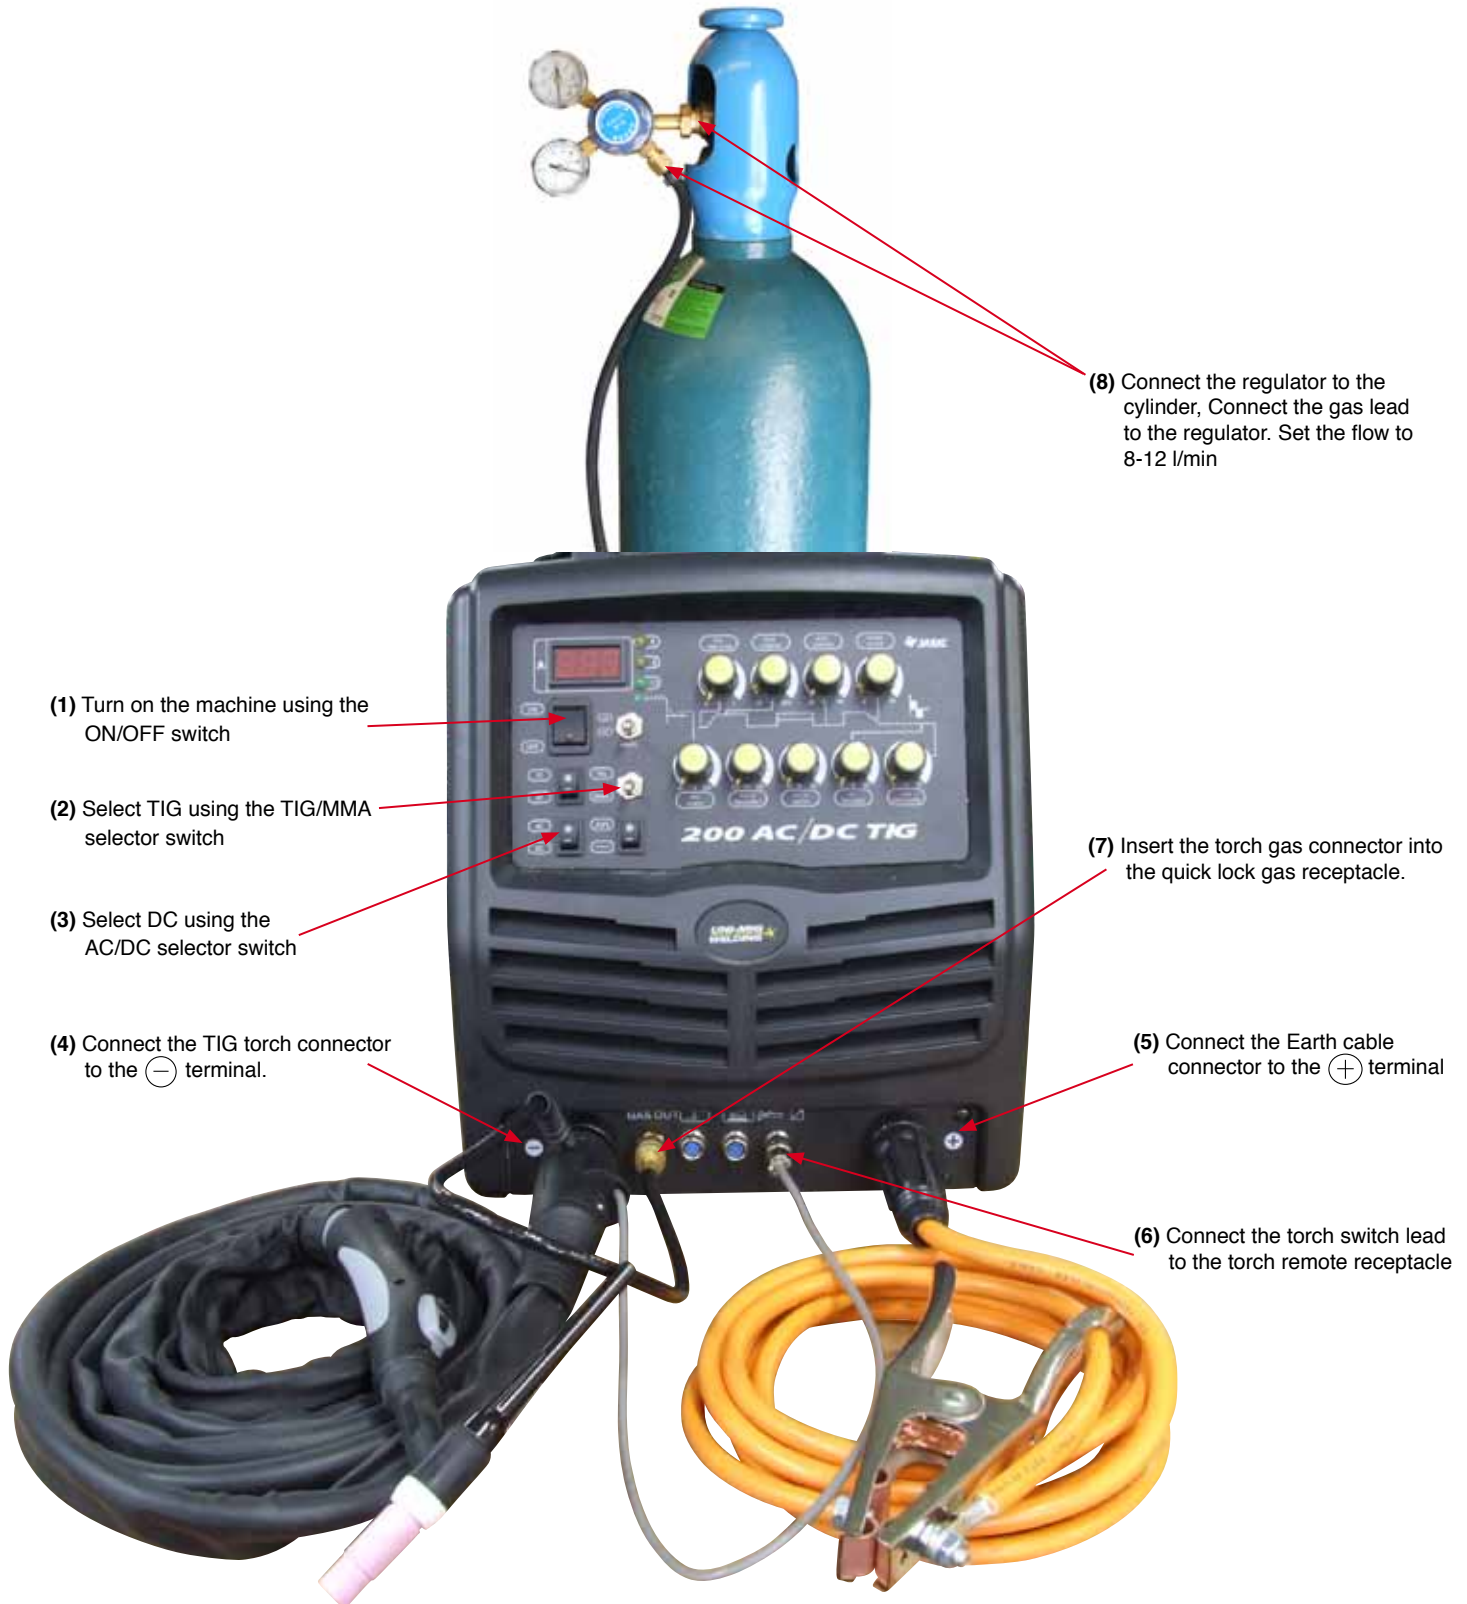


DC HF TIG Operation with KUMJR200AC/DC



HF (high frequency) ignition allows the arc to be started in TIG welding without touching the tungsten to the work piece. By pressing the torch switch the machine will activate the gas flow and the HF ignition resulting in the arc igniting across the gap between the tungsten electrode and the work piece. The distance between the electrode and the work piece can be up to 5mm. This arc ignition method prevents tungsten inclusion in the work piece, promotes longer tungsten life and offers better operator control over the starting and stopping the arc.

- (1) Assemble the front end torch parts use the correct size and type of tungsten electrode for the job, the tungsten electrode requires a sharpened point for DC welding.
- (2) Choose **2T** or **4T** trigger function preferred as per the descriptions below
2T Selection provides 2 times function of the torch switch.
 - (1) Pressing the torch switch gives arc ignition and initializes the welding current and the welding current is maintained by the torch remaining on.
 - (2) Releasing the torch switch stops the welding by introducing down slope and the current falls to minimum level and then terminates the welding current and introduces the post flow gas.**4T Selection** provides 4 times function of the torch switch
 - (1) Pressing the torch switch gives arc ignition and initializes the welding current
 - (2) Releasing the torch switch continues the welding operation.
 - (3) Pressing the torch switch and holding introduces down slope and current falls to minimum current.
 - (4) Releasing the torch switch terminates the welding operation and introduces the post flow gas.
- (3) Choose the preferred welding current (amperage) to suit the tungsten size material type and thickness to be welded.
- (4) Lay the outside edge of the Gas Cup on the work piece with the Tungsten Electrode 1- 3mm from the work piece this method will provide a clean positive arc ignition.
- (5) Press the torch switch and the arc will ignite across the gap between the tungsten and work piece. Hold even distance of about 2mm gap between the tungsten and work piece to maintain the arc.
- (6) Release the torch switch to bring in the end of the welding sequence dependant of 2T or 4T trigger function choice.

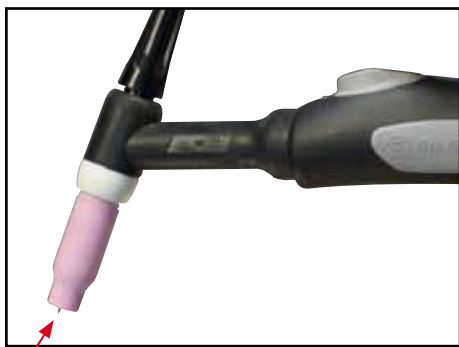

(1) Assemble the front end torch parts use the correct size and type of tungsten electrode for the job, the tungsten electrode requires a sharpened point for DC welding




(2) Select 2T or 4T trigger function as required



(3) Set the Peak Current (amps) to suit the tungsten size material type and thickness to be welded.



(4) Lay the outside edge of the Gas Cup on the work piece with the Tungsten Electrode 1- 3mm from the work piece

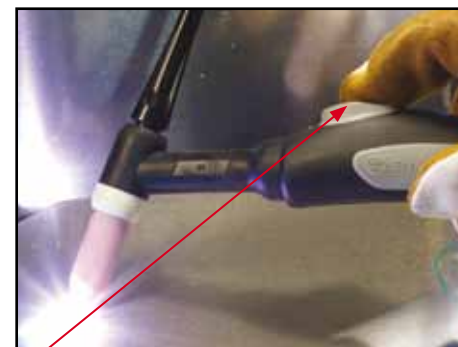


(5) Press the torch switch and the arc will ignite across the gap between the tungsten and work piece. Hold even distance of about 2mm gap between the tungsten and work piece to maintain the arc.




(6) Release the torch switch to bring in the end of the welding sequence dependant of 2T or 4T trigger function choice

DC TIG Welding General Description

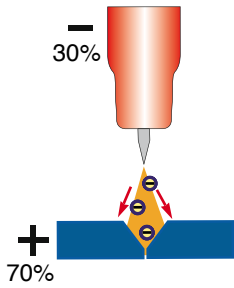


The DC power source uses what is known as DC (direct current) in which the main electrical component known as electrons flow in only one direction from the negative pole (terminal) to the positive pole (terminal). In the DC electrical circuit there is an electrical principle at work which should always be taken into account when using any DC circuit. With a DC circuit 70% of the energy (heat) is always on the positive side. This needs to be understood because it determines what terminal the TIG torch will be connected to (this rule applies to all the other forms of DC welding as well).

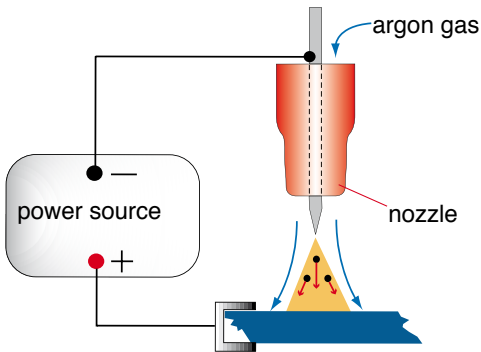


DC TIG welding is a process in which an arc is struck between a TUNGSTEN electrode and the metal work piece. The weld area is shielded by an inert gas flow to prevent contamination of the tungsten, molten pool and weld area.

When the TIG arc is struck the inert gas is ionized and superheated changing its molecular structure which converts it into a plasma stream. This plasma stream flowing between the tungsten and the work piece is the TIG arc and can be as hot as 19,000°C. It is a very pure and concentrated arc which provides the controlled melting of most metals into a weld pool. TIG welding offers the user the greatest amount of flexibility to weld the widest range of material and thickness and types. DC TIG welding is also the cleanest weld with no sparks or spatter.

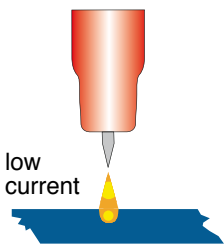


The intensity of the arc is proportional to the current that flows from the tungsten. The welder regulates the welding current to adjust the power of the arc. Typically thin material requires a less powerful arc with less heat to melt the material so less current (amps) is required, thicker material requires a more powerful arc with more heat so more current (amps) are necessary to melt the material.

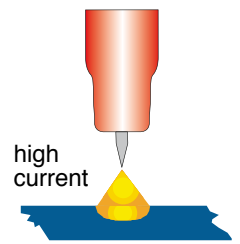

HF ARC IGNITION for TIG (tungsten inert gas) Welding

HF (high frequency) ignition allows the arc to be started in TIG welding without touching the tungsten to the work piece. By pressing the torch switch the machine will activate the gas flow and introduce the HF (high frequency) (high voltage) spark, this "ionizes" the air gap making it conductive allowing an arc to be created without touching the tungsten to the work piece. The gas molecules are superheated by the arc creating a stream of super heated gas that changes the molecular structure into producing a plasma stream. This plasma stream provides heat and energy that allows us to melt and fuse metals in an inert gas shielded environment know as TIG (tungsten inert gas) welding.

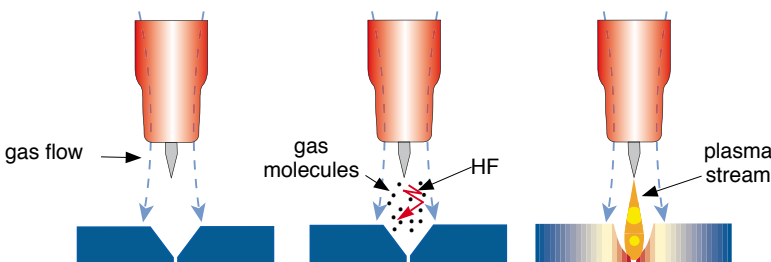

DC Pulse TIG Welding General Description

Pulse TIG welding is when the current output (amperage) changes between high and low current. Electronics within the welding machine create the pulse cycle. Welding is done during the high-amperage interval (this high amperage is referred to as peak current). During the low amperage period, the arc is maintained but the current output of the arc is reduced (this low amperage is referred to as base current). During pulse welding the weld pool cools during the low amperage period. This allows a lower overall heat input into the base metal. It allows for controlled heating and cooling periods during welding providing better control of heat input, weld penetration, operator control and weld appearance.

There are 4 variables within the pulse cycle:

Peak Current - Base Current - Pulse Frequency - Pulse Width


Setting and manipulation of these variables will determine the nature of the weld current output and is at the discretion of the operator.

Peak Current is the main welding current (amps) set to melt the material being welded and works much the same as setting maximum amperage values for regular DC TIG: as a guide use 30-40 amps for every 1mm of material thickness.


Base Current is the set level of background current (amps) which cools the weld puddle and affects overall heat input. Background Amps is a percentage of peak amperage. As a rule, use enough background current to reduce the weld pool to about half its normal size while still keeping the weld pool fluid. As a guide start by setting the background amperage at 20 to 30 percent of peak amperage.

Pulse Frequency is the control of the amount of times per second (Hz) that the welding current switches from Peak Current to Base Current. DC Pulse TIG frequency generally ranges from 20 to 300 HZ depending on the job application. Control of the pulse frequency also determines the appearance of the weld.

Pulse Width is the control of the percentage of time during one pulsing cycle the power source spends at the peak current (main amperage). Example is with the Pulse Width set at 80 percent and a rate of 1 pulse per second (PPS), the machine will spend 80% of the pulse at peak amperage and 20% at the base current. Increasing the pulse width percentage adds more heat to the job, while decreasing pulse width percentage reduces heat

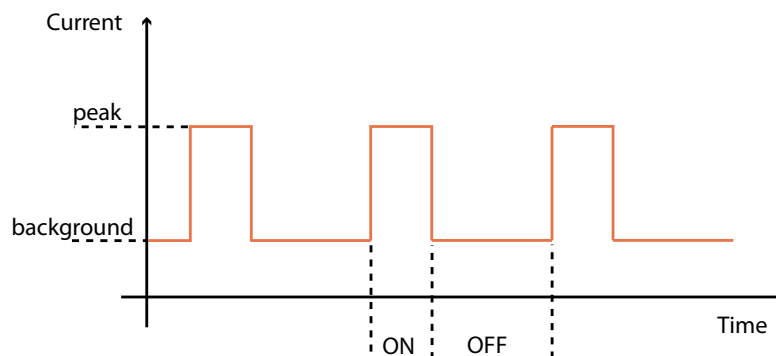

DC Pulse Tig welding allows faster welding speeds with better control of the heat input to the job, reducing the heat input minimising distortion and warping of the work and is of particular advantage in the welding of thin stainless steel and carbon steel applications. The high pulse frequency capability of the advanced inverter agitates the weld puddle and allows you to move quickly without transferring too much heat to the surrounding metal. Pulsing also constricts and focuses the arc thus increasing arc stability, penetration and travel speeds.

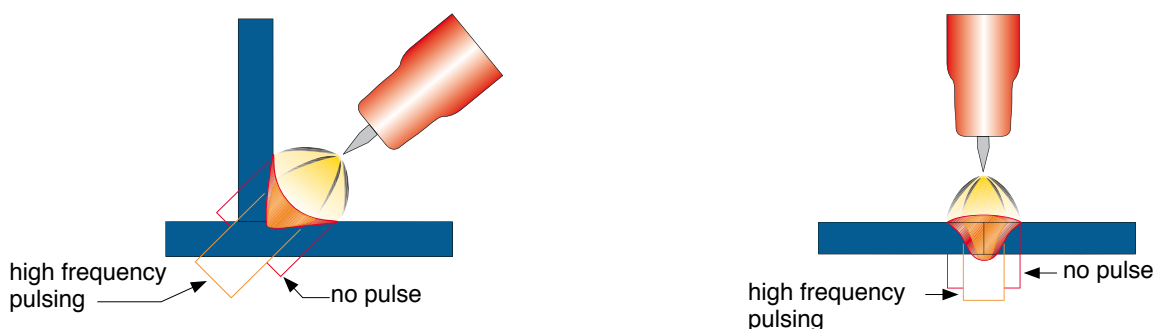


EXAMPLE 1 OF PULSE DC TIG WELDING - SETUP PARAMETERS:

Material = Stainless Steel x 2.0mm / Tungsten Electrode = 1.6mm 2% Thoriated / Gas = Argon

The following steps are a guide as a starting point for you to set the machine up in Pulse mode to give an example of welding in Pulse mode function. You can experiment by changing any of the variables to see what effect it has over the welding and what the end result can be, but it is suggested to change only one variable at a time and then check the welding to see what the result is, in this way you acquire a better understanding of how each variable affects the welding current.

- (1) Prepare the machine for DC TIG welding as per the DC HF TIG operating guide on page 18
- (2) Set the **Peak Current** at 110 Amps
- (3) Set the **Base Current** around 30% (Base Current is % of the Peak Current eg 30% of 110 = 33 Amps)
- (4) Set the **Pulse Frequency** around 2Hz (pulses per second)
- (5) Set the **Pulse Width** around 50% (the current will be 50% at Peak Current and 50% at Base Current)

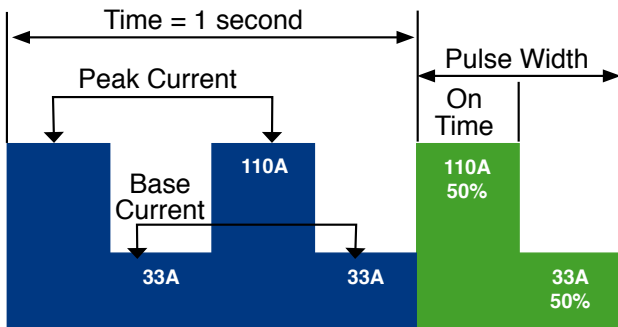

(2) Set the Peak Current at 110 Amps



(3) Set the Base Current at 30%




(4) Set the Pulse Frequency at 2 Hz



(5) Set the Pulse Width at 50%



(6) Set the Pulse Selector switch to Pulse

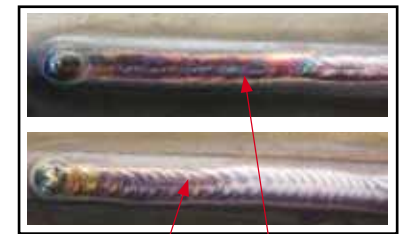


Example of Pulse vs Non Pulse weld finish

EXAMPLE 2 OF PULSE DC TIG WELDING - SETUP PARAMETERS:


Material = Mild Steel x 4.0mm / Tungsten Electrode = 2.4mm 2% Thoriated / Gas = Argon

- (1) Set the **Peak Current** at 150 Amps
- (2) Set the **Base Current** around 20% (Base Current is % of the Peak Current eg 40% of 180 = 72 Amps)
- (3) Set the **Pulse Frequency** around 1Hz (pulse per second)
- (4) Set the **Pulse Width** around 80% (the current will spend 80% at Peak Current and 20% at Base Current)

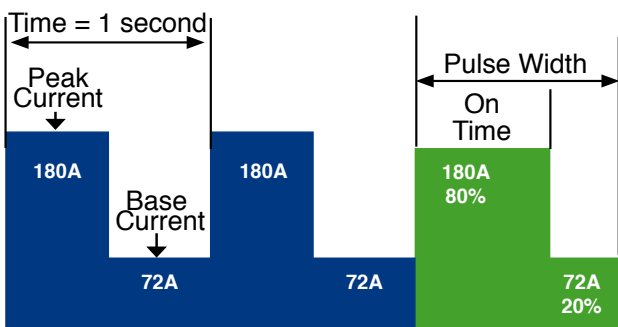



NOTE: Do not use a tungsten electrode that has been used on mild steel or stainless steel as it can contaminate the welding material

TIG Welding Fusion Technique

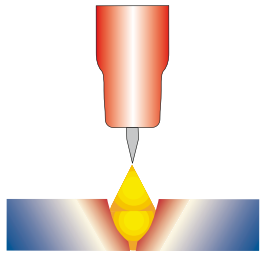


Manual TIG welding is often considered the most difficult of all the welding processes. Because the welder must maintain a short arc length, great care and skill are required to prevent contact between the electrode and the workpiece. Similar to Oxygen Acetylene torch welding, Tig welding normally requires two hands and in most instances requires the welder to manually feed a filler wire into the weld pool with one hand while manipulating the welding torch in the other. However, some welds combining thin materials can be accomplished without filler metal like edge, corner, and butt joints.

This is known as Fusion welding where the edges of the metal pieces are melted together using only the heat and arc force generated by the TIG arc. Once the arc is started the torch tungsten is held in place until a weld pool is created, a circular movement of the tungsten will assist in creating a weld pool of the desired size. Once the weld pool is established tilt the torch at about a 75° angle and move smoothly and evenly along the joint while fusing the materials together.





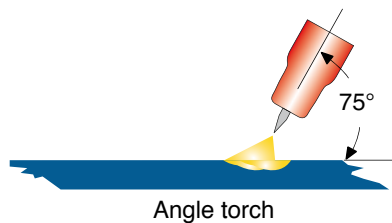
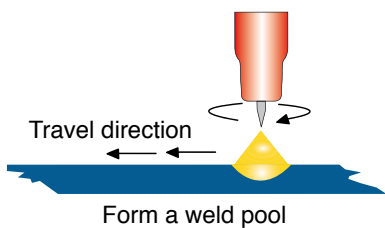


TIG Welding with Filler Wire Technique

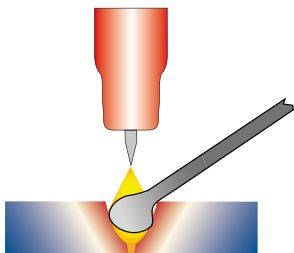

It is necessary in many situations with TIG welding to add a filler wire into the weld pool to build up weld reinforcement and create a strong weld. Once the arc is started the torch tungsten is held in place until a weld pool is created, a circular movement of the tungsten will assist in creating a weld pool of the desired size. Once the weld pool is established tilt the torch at about a 75° angle and move smoothly and evenly along the joint. The filler metal is introduced to the leading edge of the weld pool. The filler wire is usually held at about a 15° angle and fed into the leading edge of the molten pool, the arc will melt the filler wire into the weld pool as the torch is moved forward.


Also a dabbing technique can be used to control the amount of filler wire added, the wire is fed into the molten pool and retracted in a repeating sequence as the torch is moved slowly and evenly forward. It is important during the welding to keep the molten end of the filler wire inside the gas shield as this protects the end of the wire from being oxidised and contaminating the weld pool.

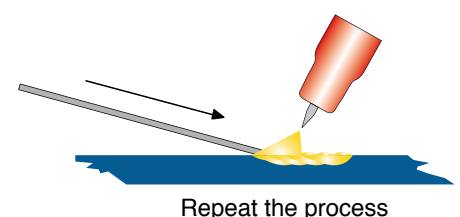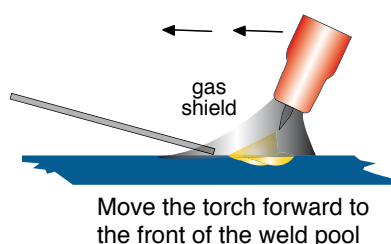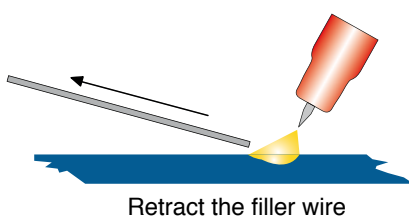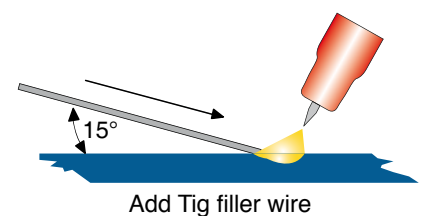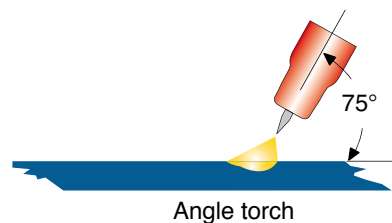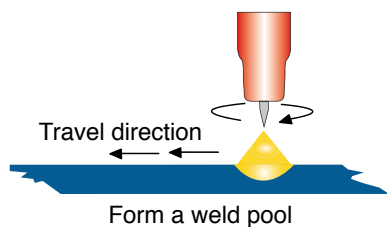



Set up and operation for AC TIG Welding - KUMJR200AC/DC

- (1) Turn on the machine using the **ON/OFF** switch
- (2) Select the **TIG** function with the **TIG/MMA** selector switch.
- (3) Select **AC** using the **AC/DC** selector switch.
- (4) Connect the **Tig Torch** connector to the **negative terminal** and tighten it.
- (5) Connect the **Earth Cable** connector into the **positive terminal** and tighten it.
- (6) Connect the torch switch remote lead into the torch remote socket
- (7) Insert the torch gas connector into the quick lock gas receptacle.
- (8) Connect gas line to Gas Regulator and connect the gas regulator to the Gas Cylinder.
Carefully open the valve of the gas cylinder, set the flow to 8-12 l/min

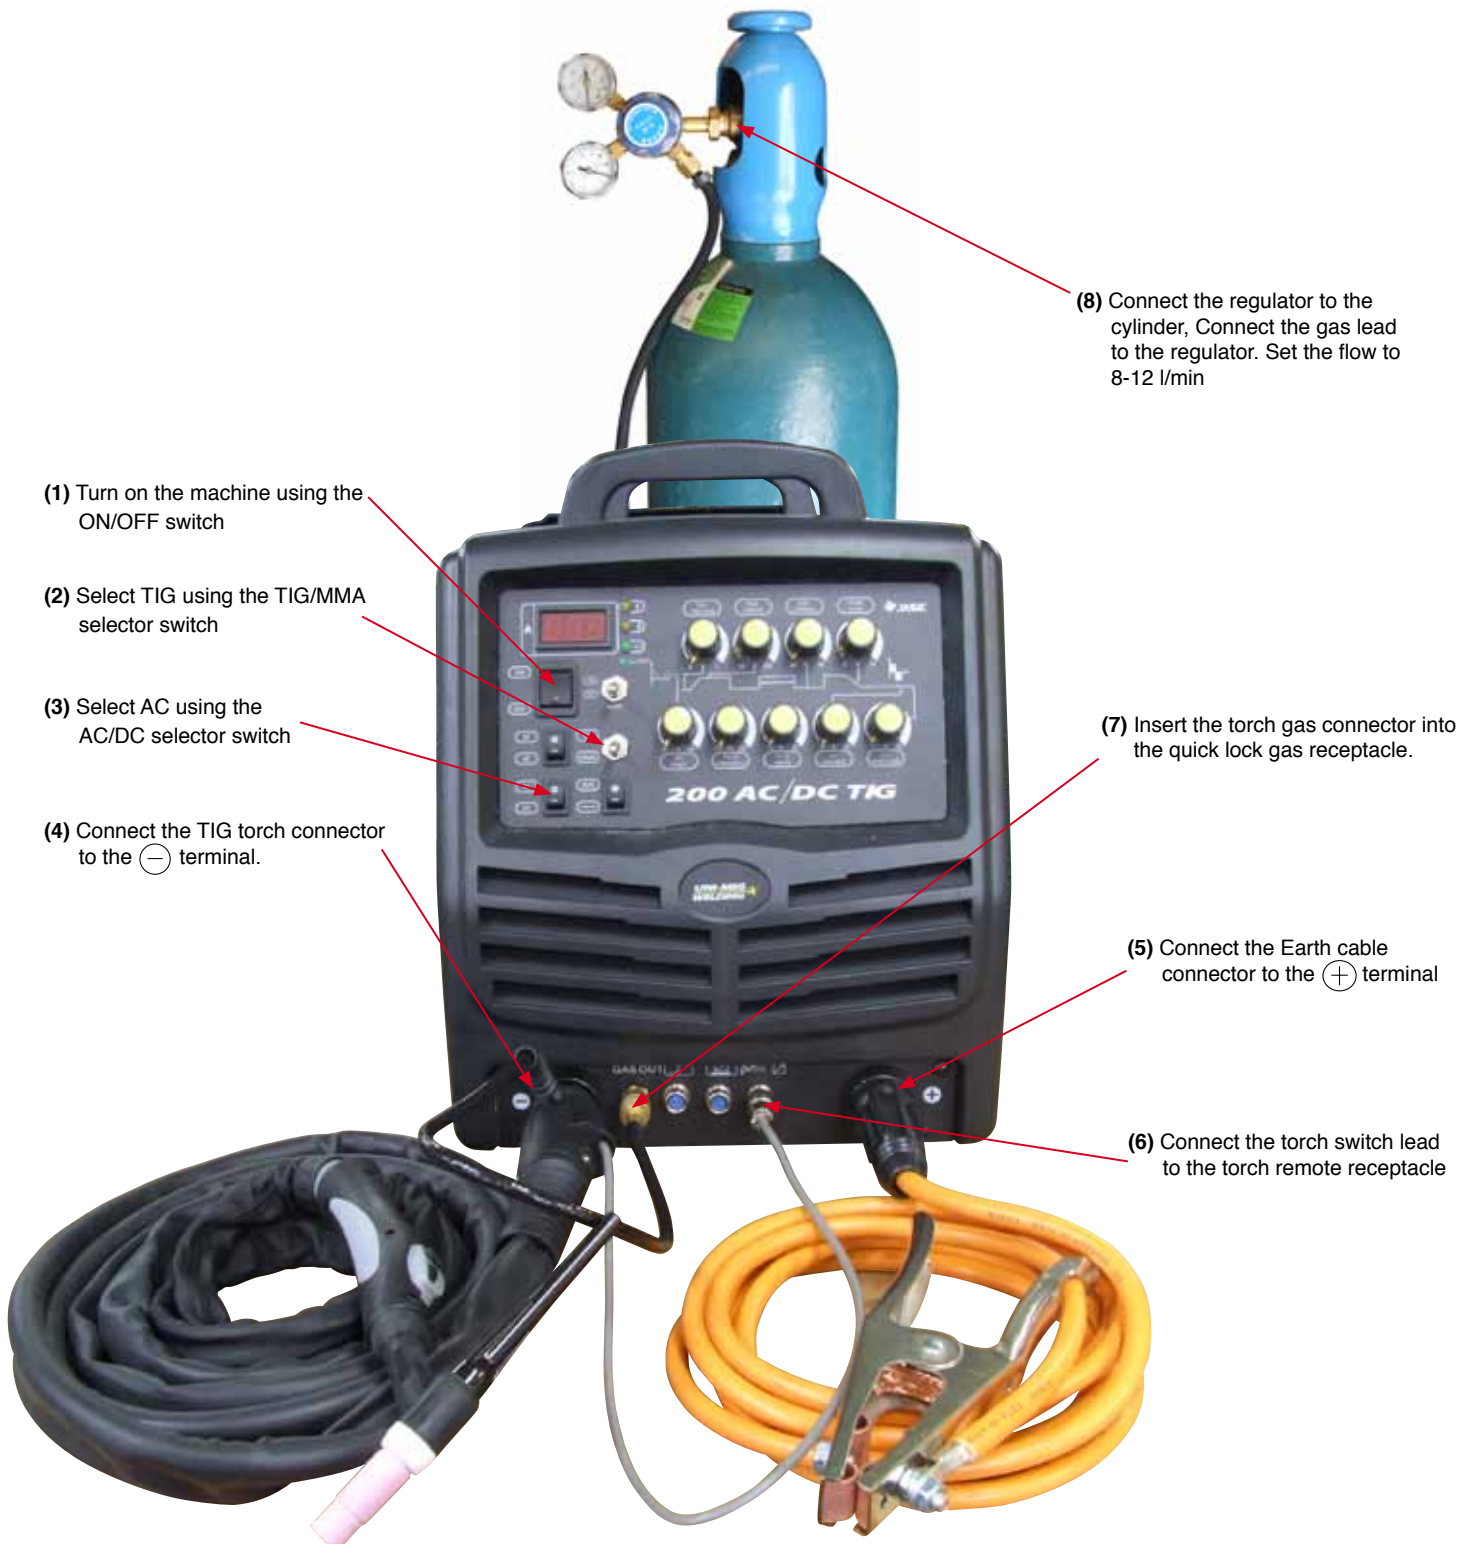

continued - Set up and operation for AC TIG Welding - KUMJR200AC/DC



AC (alternating current) enables us to TIG weld non ferrous alloys like Aluminium, Aluminium Alloys and Magnesium. These materials have an insulating surface oxide layer that melts at a higher temperature than the base metal making it difficult to weld the base metal if the oxides are not removed. AC welding current is ideal because the nature of the AC wave form assists in breaking the surface oxide layer. HF arc ignition provides easy and precise starting of the arc, see page 18 &19 for HF start explanation.

- (9) Assemble the front end torch parts using the correct size and type of tungsten electrode for the job.
- (10) Choose **2T** or **4T** trigger function preferred as per the descriptions below
2T Selection provides 2 times function of the torch switch.
 - (1) Pressing the torch switch gives arc ignition and initializes the welding current and the welding current is maintained by the torch remaining on.
 - (2) Releasing the torch switch stops the welding by introducing down slope and the current falls to minimum level and then terminates the welding current and introduces the post flow gas.**4T** Selection provides 4 times function of the torch switch
 - (1) Pressing the torch switch gives arc ignition and initializes the welding current
 - (2) Releasing the torch switch continues the welding operation.
 - (3) Pressing the torch switch and holding introduces down slope and current falls to minimum current.
 - (4) Releasing the torch switch terminates the welding operation and introduces the post flow gas.
- (11) Choose the preferred welding current (amperage) to suit the tungsten size material type and thickness to be welded.
- (12) Set the AC Balance control to approximately 25%
- (13) Lay the outside edge of the Gas Cup on the work piece with the Tungsten Electrode 1- 3mm from the work piece this method will provide a clean positive arc ignition.
- (14) Press the torch switch and the arc will ignite across the gap between the tungsten and work piece. Hold even distance of about 2mm gap between the tungsten and work piece to maintain the arc.



(9) Assemble the front end torch parts using the correct size and type of tungsten electrode for the job, the tungsten electrode does not require a sharpened point for AC welding



(10) Select 2T or 4T trigger function as required



(11) Set the Peak Current (amps) to suit the tungsten size material type and thickness to be welded.



(12) Set the AC Balance Control to 25%



(13) Lay the outside edge of the Gas Cup on the work piece with the Tungsten Electrode 1- 3mm from the work piece




(14) Press the torch switch and the arc will ignite across the gap between the tungsten and work piece. Hold even distance of about 2mm gap between the tungsten and work piece to maintain the arc.

AC Welding

AC (alternating current) enables us to TIG weld non ferrous alloys like Aluminium, Magnesium and Aluminium Alloys. These materials have an insulating surface oxide layer that melts at a higher temperature than the base metal making it difficult to weld the base metal if the oxides are not removed. AC welding current is ideal because the nature of the AC wave form assists in breaking the surface oxide layer.


AC (alternating current) has a current cycle that flows from + (direct) polarity to - (reverse) polarity.

The reversing of the polarity breaks the surface oxide while the direct polarity melts the base material.

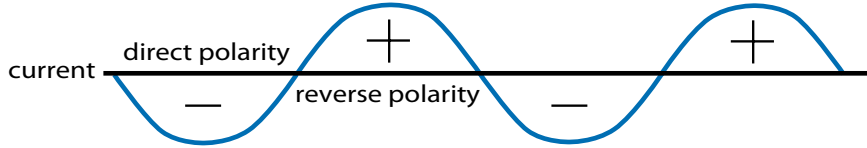


There are inherent problems that come with AC TIG arc rectification, arc stutter, arc wandering and arc stoppage. These problems typically occur during the transition between + and - cycles.

The current is less (30%) during the half of the cycle when the electrode is positive and there is a resistance of the electron flow during this half cycle (rectification). The lack of current flow during this half cycle makes the AC arc unstable.

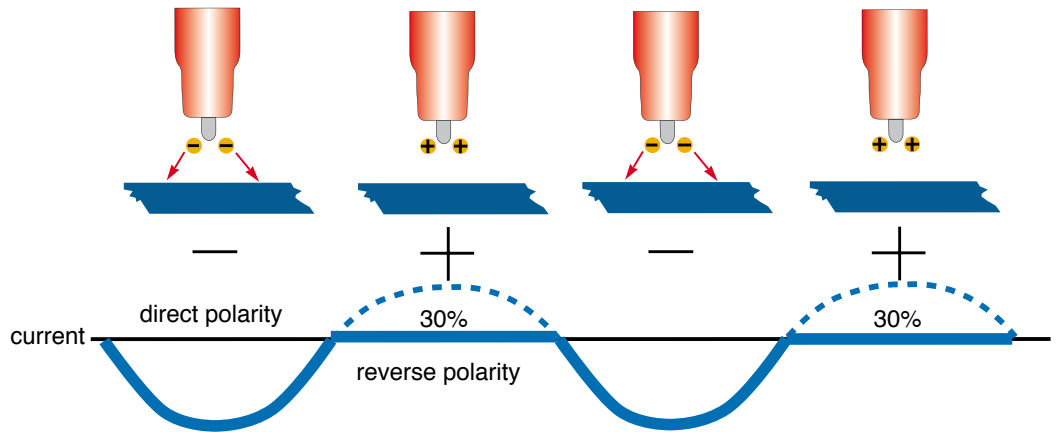


To overcome this lack of flow during one half of the cycle, a high-frequency (HF) voltage is generated and fed into the welding circuit. The HF maintains the arc stability during the half cycle when the electrode is positive.

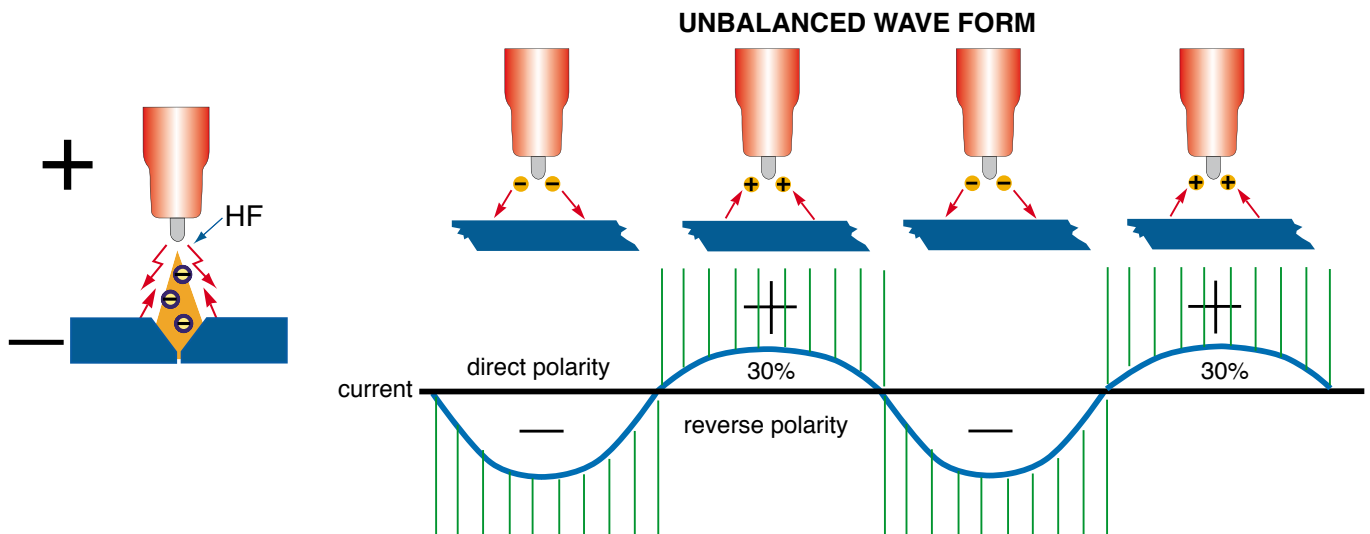


High-frequency voltage flows continually in the welding circuit and keeps the shielding arc in the welding area in an ionized state. When the arc is ionized the arc is maintained during the half of the cycle when the electrode is positive. However while the arc is maintained less current flows during this half of the AC cycle, producing an unbalanced wave.



In older machines, a balanced current output wave was achieved using a large number of capacitors in series or a battery in the welding circuit. Modern TIG power sources use electronics to create and maintain a balanced wave and now most AC TIG power sources produce a square wave current output.

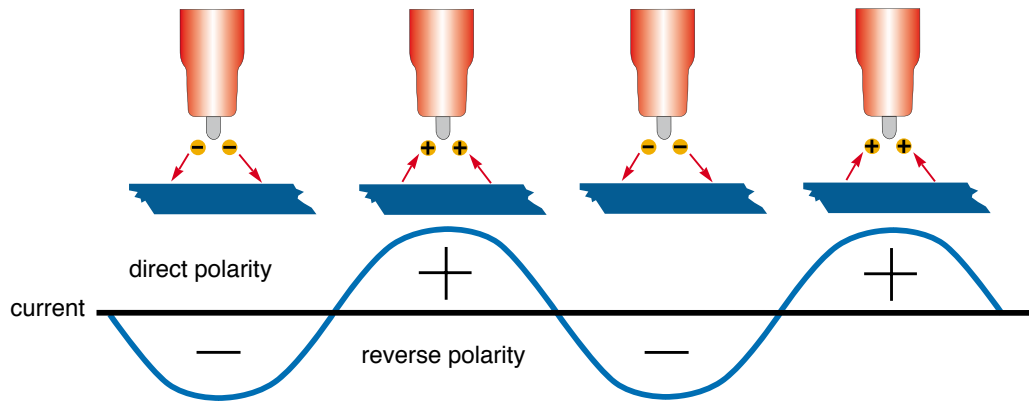

A square wave power supply can change the current from electrode + positive to electrode - negative very quickly. This produces high voltage as the current switches polarities allowing the arc to restart easily. The arc can be maintained without the use of high-frequency or any other arc stabilising methods.

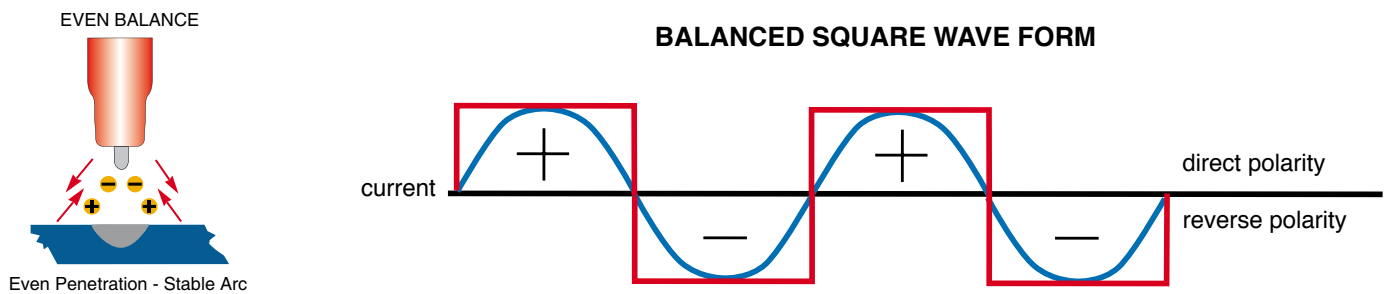

The output current and voltage are controlled electronically so the amount of current electrode positive and the amount of current electrode negative can be adjusted. This allows the welder to adjust the amount of cleaning and the amount of penetration. This is achieved electronically by adjusting the balance control dial on the welding machine. More current flow from the + direct polarity produces stronger arc energy and current flow from the tungsten and is good for removing the oxidized surface of the work piece. However too much + current flow can drive too much energy to the tungsten causing it to overheat and melt the tungsten electrode.

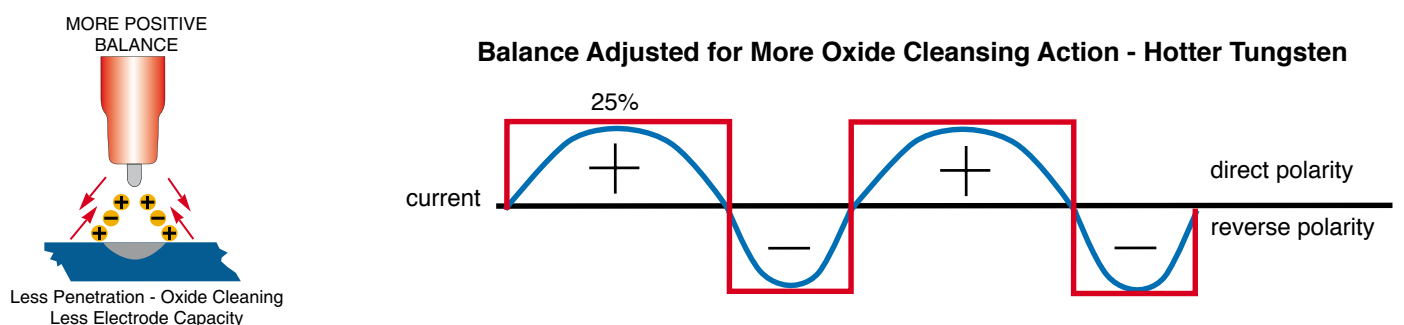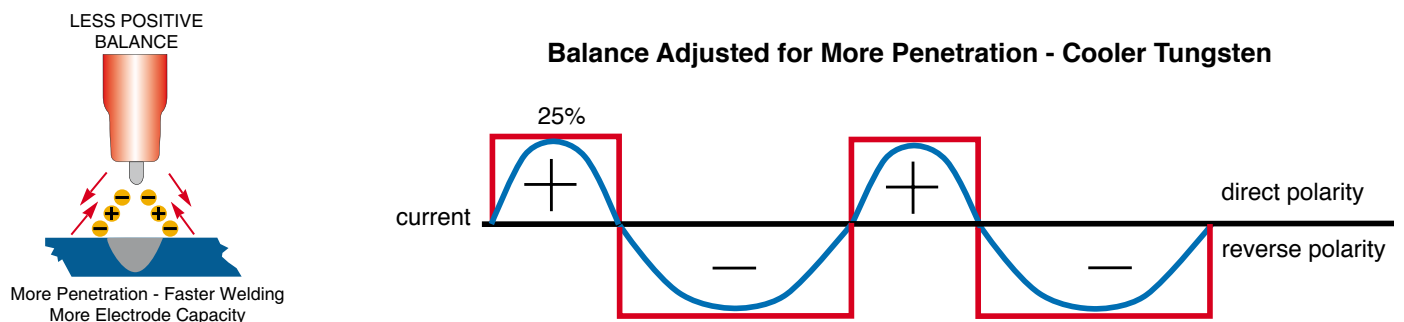


EXAMPLE 1: PULSE AC TIG WELDING - SETUP PARAMETERS:

Material = Aluminium x 3.0mm / Tungsten Electrode = 2.4mm Zirconiated / Gas = Argon

The following steps are a guide as a starting point for you to set the machine up in AC Pulse mode to give an example of welding in AC Pulse TIG function. You can experiment by changing any of the variables to see what effect it has over the welding and what the end result can be, but it is suggested to change only one variable at a time and then check the welding to see what the result is, in this way you acquire a better understanding of how each variable affects the welding current.

- (1) Prepare the machine for AC TIG welding as per the AC TIG operating guide on page 23
- (2) Set the **Peak Current** at 150 Amps
- (3) Set the **Base Current** around 40% (Base Current is % of the Peak Current eg 40% of 150 = 60 Amps)
- (4) Set the **Pulse Frequency** around 1Hz (pulses per second)
- (5) Set the **Pulse Width** around 60% (the current will spend 60% at Peak Current & 40% at Base Current)

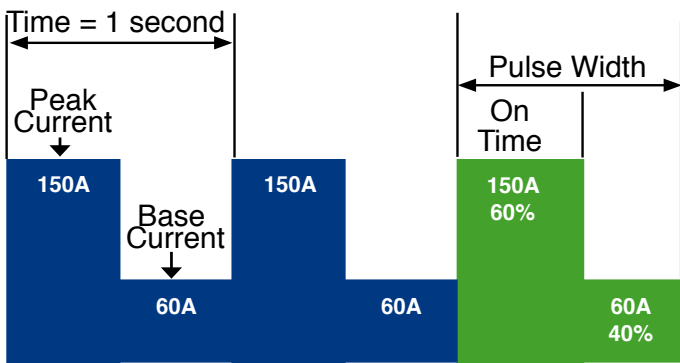

(2) Set the Peak Current at 110 Amps



(3) Set the Base Current at 30%




(4) Set the Pulse Frequency at 2 Hz



(5) Set the Pulse Width at 50%



(6) Set the Pulse Selector switch to Pulse

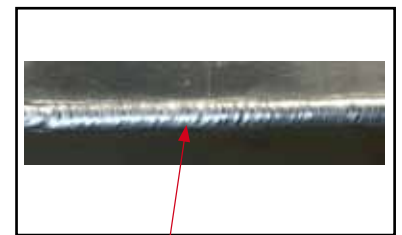



Example of Pulsed weld finish

Remote Amperage Controls - Installation and Operation



Remote amperage controls allow for the welding current to be adjusted remotely from the welding machine during welding. Generally there are several types of remote amperage control available;

- (1) Hand amperage control located in the torch handle allowing the operator to adjust the welding current by rolling the potentiometer wheel to increase or decrease the amount of amperage desired.
- (2) Foot amperage control that is a foot pedal that allows the operator to adjust the welding current by depressing the pedal to increase the amperage desired and releasing the pedal to decrease.
- (3) Box amperage control that is a small box housing a potentiometer with a knob that the operator can adjust the welding current turning the knob to increase or decrease the amount of amperage desired.

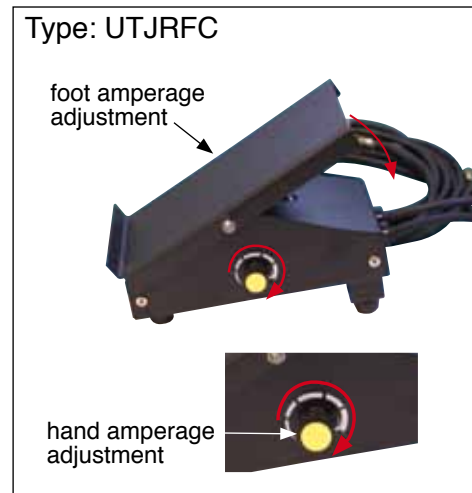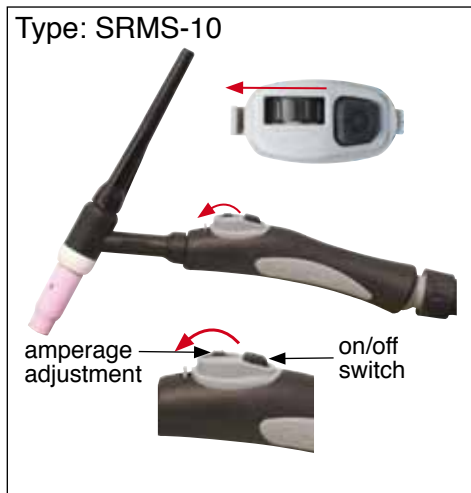

Connection and operation of the remote hand control



(1) Place the remote selector switch on the front panel of machine in the remote position. This bypasses the current control on the machine giving the current control to the remote control.



(2) Connect the remote control 7 pin plug from the Tig Torch switch lead to the 7 pin remote receptacle on the front panel of the machine.



(3) Press the **switch** to activate the machine. Rotate the **amp control** potentiometer to select the desired welding current.


Connection and operation of the remote foot control



(1) Place the remote selector switch on the front panel of machine in the remote position. This bypasses the current control on the machine giving the current control to the remote control.



(2) Connect the remote control 7 pin plug from the Tig Torch switch lead to the 7 pin remote receptacle on the front panel of the machine.

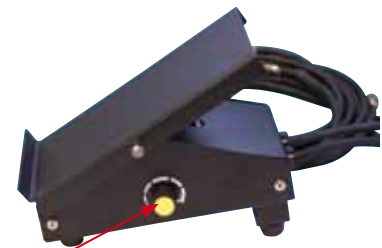

(3) Set the dial on the foot control to the desired setting eg - Max = Maximum current output, 50% = 50% of the maximum current output of the machine. Depress the foot pedal to activate the machine, further depressing the pedal will increase the current level to the maximum set by the dial on the foot control.

Tungsten Electrodes

Tungsten is a rare metallic element used for manufacturing TIG welding electrodes. The TIG process relies on tungsten's hardness and high-temperature resistance to carry the welding current to the arc. Tungsten has the highest melting point of any metal, 3,410 degrees Celsius.

Tungsten electrodes are nonconsumable and come in a variety of sizes, they are made from pure tungsten or an alloy of tungsten and other rare earth elements. Choosing the correct tungsten depends on the material being welded, the amount of amps required and whether you are using AC or DC welding current.

Tungsten electrodes are colour-coded at the end for easy identification.

Below are the most commonly used tungsten electrodes found in the New Zealand and Australian market.

Thoriated

Thoriated tungsten electrodes (AWS classification EWTh-2) contain a minimum of 97.30 percent tungsten and 1.70 to 2.20 percent thorium and are called 2 percent thoriated. They are the most commonly used electrodes today and are preferred for their longevity and ease of use. Thorium increases the electron emission qualities of the electrode, which improves arc starts and allows for a higher current-carrying capacity. This electrode operates far below its melting temperature, which results in a considerably lower rate of consumption and eliminates arc wandering for greater stability. Compared with other electrodes, thoriated electrodes deposit less tungsten into the weld puddle, so they cause less weld contamination.

Thorium however is a low-level radioactive hazard and many users have switched to other alternatives. Regarding the radioactivity, thorium is an alpha emitter but when it is enclosed in a tungsten matrix the risks are negligible. Thus holding a stick of Thoriated tungsten in your hand should not pose a great threat unless a welder has open cuts on their skin. Thoriated tungsten should not get in contact with open cuts or wounds. The more significant danger to welders can occur when thorium oxide gets into the lungs. This can happen from the exposure to vapours during welding or from ingestion of material/dust in the grinding of the tungsten. Follow the manufacturer's warnings, instructions, and the Material Safety Data Sheet (MSDS) for its use.

Ceriated (Color Code: Orange)

Ceriated tungsten electrodes (AWS classification EWCe-2) contain a minimum of 97.30 percent tungsten and 1.80 to 2.20 percent cerium and are referred to as 2 percent ceriated. Ceriated tungstens perform best in DC welding at low current settings. They have excellent arc starts at low amperages and become popular in such applications as orbital tube welding, thin sheet metal work. They are best used to weld carbon steel, stainless steel, nickel alloys, and titanium, and in some cases it can replace 2 percent thoriated electrodes. Ceriated tungsten is best suited for lower amperages it should last longer than Thoriated tungsten higher amperage applications are best left to Thoriated or Lanthanated tungsten.

Lanthanated (Color Code: Gold)

Lanthanated tungsten electrodes (AWS classification EWLa-1.5) contain a minimum of 97.80 percent tungsten and 1.30 percent to 1.70 percent lanthanum, and are known as 1.5 percent lanthanated. These electrodes have excellent arc starting, a low burn off rate, good arc stability, and excellent re-ignition characteristics. Lanthanated tungstens also share the conductivity characteristics of 2 percent thoriated tungsten. Lanthanated tungsten electrodes are ideal if you want to optimise your welding capabilities. They work well on AC or DC electrode negative with a pointed end, or they can be balled for use with AC sine wave power sources. Lanthanated tungsten maintains a sharpened point well, which is an advantage for welding steel and stainless steel on DC or AC from square wave power sources.

Zirconiated (Color Code: White)

Zirconiated tungsten electrodes (AWS classification EWZr-1) contain a minimum of 99.10 percent tungsten and 0.15 to 0.40 percent zirconium. Most commonly used for AC welding Zirconiated tungsten produces a very stable arc and is resistant to tungsten spitting. It is ideal for AC welding because it retains a balled tip and has a high resistance to contamination. Its current-carrying capacity is equal to or greater than that of thoriated tungsten. Zirconiated tungsten is not recommended for DC welding.

Tungsten Electrodes Rating for Welding Currents

Tungsten Diameter mm	DC Current Amps Torch Negative 2% Thoriated	AC Current Amps Un-Balanced Wave 0.8% Zirconiated	AC Current Amps Balanced Wave 0.8% Zirconiated
1.0mm	15 - 80	15 - 80	20 - 60
1.6mm	70 - 150	70 - 150	60 - 120
2.4mm	150 - 250	140 - 235	100 - 180
3.2mm	250 - 400	225 - 325	160 - 250
4.0mm	400 - 500	300 - 400	200 - 320

Tungsten Preparation

Always use **DIAMOND** wheels when grinding and cutting. While tungsten is a very hard material, the surface of a diamond wheel is harder, and this makes for smooth grinding. Grinding without diamond wheels, such as aluminium oxide wheels, can lead to jagged edges, imperfections, or poor surface finishes not visible to the eye that will contribute to weld inconsistency and weld defects.

Always ensure to grind the tungsten in a longitudinal direction on the grinding wheel. Tungsten electrodes are manufactured with the molecular structure of the grain running lengthwise and thus grinding crosswise is “grinding against the grain.” If electrodes are ground crosswise, the electrons have to jump across the grinding marks and the arc can start before the tip and wander. Grinding longitudinally with the grain, the electrons flow steadily and easily to the end of the tungsten tip. The arc starts straight and remains narrow, concentrated, and stable.



Electrode Tip/Flat

 
The shape of the tungsten electrode tip is an important process variable in precision arc welding. A good selection of tip/flat size will balance the need for several advantages. The bigger the flat, the more likely arc wander will occur and the more difficult it will be to arc start. However, increasing the flat to the maximum level that still allows arc start and eliminates arc wander will improve the weld penetration and increase the electrode life. Some welders still grind electrodes to a sharp point, which makes arc starting easier. However, they risk decreased welding performance from melting at the tip and the possibility of the point falling off into the weld pool.



Electrode Included Angle/Taper - DC Welding

Tungsten electrodes for DC welding should be ground longitudinally and concentrically with diamond wheels to a specific included angle in conjunction with the tip/flat preparation. Different angles produce different arc shapes and offer different weld penetration capabilities. In general, blunter electrodes that have a larger included angle provide the following benefits:

- Last Longer
- Have better weld penetration
- Have a narrower arc shape
- Can handle more amperage without eroding.



Sharper electrodes with smaller included angle provide:

- Offer less arc weld
- Have a wider arc
- Have a more consistent arc




The included angle determines weld bead shape and size. Generally, as the included angle increases, penetration increases and bead width decreases.

Tungsten Diameter	Diameter at the Tip - mm	Constant Included Angle - Degrees	Current Range Amps	Current Range Pulsed Amps
1.0mm	.250	20	05 - 30	05 - 60
1.6mm	.500	25	08 - 50	05 - 100
1.6mm	.800	30	10 - 70	10 - 140
2.4mm	.800	35	12 - 90	12 - 180
2.4mm	1.100	45	15 - 150	15 - 250
3.2mm	1.100	60	20 - 200	20 - 300
3.2mm	1.500	90	25 - 250	25 - 350

Tungsten preparation AC Welding

To obtain full current capacity from a pure or zirconiated tungsten electrode when used with AC current output the electrode is not ground to a point. The welding during positive polarity melts the point of the tungsten that becomes rounded. The ball shape formed at the end of the tungsten is desirable because it reduces current rectification and allows the arc to flow more easily.

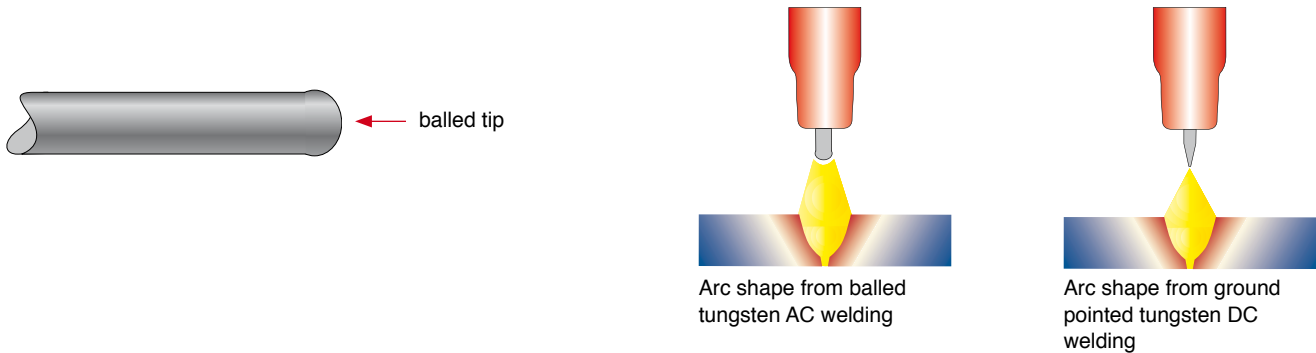

Safety with tungsten electrodes

Tungsten welding electrodes should never be manually ground on an abrasive belt or wheel (particularly silicone carbide). Always use diamond wheels when grinding and cutting tungstens. The risk of injury when hand (manually) grinding a very hard brittle material like tungsten is quite high. It is important to always follow standard safety guidelines when operating high speed grinding equipment.

- Wear approved safety glasses
- No loose clothing which may get caught in moving parts
- Wear protective hair covering to contain long hair
- Wear safety shoes with non-slip sole
- A vacuum system is recommended to remove tungsten, especially thorium dust
- Never operate power tools when tired, intoxicated or when taking medication that causes drowsiness

The most common injuries to the manual tungsten electrode grinder are eye and finger related. Holding and grinding the tungsten electrode by hand has resulted in burned fingers, laceration to fingers and splintered tungsten electrodes in hand or fingers. Eye injury generally occurs from manually grinding tungsten electrodes without a safety shield or safety glasses. Small slivers of tungsten electrode may become stuck in the operator's eye.

MMA (Stick) WELDING TROUBLE SHOOTING

The following chart addresses some of the common problems of MMA welding. In all cases of equipment malfunction, the manufacturer's recommendations should be strictly adhered to and followed.

1: No arc	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Incomplete welding circuit	Check earth lead is connected. Check all cable connections.
Wrong mode selected	Check the MMA selector switch is selected
No power supply	Check that the machine is switched on and has a power supply
2: Porosity – small cavities or holes resulting from gas pockets in weld metal.	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Arc length too long	Check that pure Argon is being used
Work piece dirty, contaminated or moisture	Remove moisture and materials like paint, grease, oil, and dirt, including mill scale from base metal
Damp electrodes	Use only dry electrodes
3: Excessive Spatter	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Amperage too high	Decrease the amperage or choose a larger electrode
Arc length too long	Shorten the arc length
3: Weld sits on top, lack of fusion	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Insufficient heat input	Increase the amperage or choose a larger electrode
Work piece dirty, contaminated or moisture	Remove moisture and materials like paint, grease, oil, and dirt, including mill scale from base metal
Poor welding technique	Use the correct welding technique or seek assistance for the correct technique
4: Lack of penetration	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Insufficient heat input	Increase the amperage or choose a larger electrode
Poor welding technique	Use the correct welding technique or seek assistance for the correct technique
Poor joint preparation	Check the joint design and fit up, make sure the material is not too thick. Seek assistance for the correct joint design and fit up
5: Excessive penetration - burn through	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Excessive heat input	Reduce the amperage or use a smaller electrode
Incorrect travel speed	Try increasing the weld travel speed
6: Uneven weld appearance	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Unsteady hand, wavering hand	Use two hands where possible to steady up, practise your technique
7: Distortion – movement of base metal during welding	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Excessive heat input	Reduce the amperage or use a smaller electrode
Poor welding technique	Use the correct welding technique or seek assistance for the correct technique
Poor joint preparation and or joint design	Check the joint design and fit up, make sure the material is not too thick. Seek assistance for the correct joint design and fit up
7: Electrode welds with different or unusual arc characteristic	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Incorrect polarity	Change the polarity, check the electrode manufacturer for correct polarity

TIG WELDING TROUBLE SHOOTING

The following chart addresses some of the common problems of TIG welding. In all cases of equipment malfunction, the manufacturer's recommendations should be strictly adhered to and followed.


1: Tungsten burning away quickly	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Incorrect Gas	Check that pure Argon is being used
No gas	Check the gas cylinder contains gas and is connected
Inadequate gas flow	Check the gas is connected, check hoses, gas valve and torch are not restricted. Set the gas flow between 10 - 15 l/min flow rate
Back cap not fitted correctly	Make sure the torch back cap is fitted so that the o-ring is inside the torch body
Torch connected to DC +	Connect the torch to the DC- output terminal
Incorrect tungsten being used	Check and change the tungsten type if necessary
Tungsten being oxidised after weld is finished	Keep shielding gas flowing 10–15 seconds after arc stoppage. 1 second for each 10 amps of weld current.
Tungsten melting back into the nozzle on AC welding	Check that correct type of tungsten is being used. Check the balance control is not set too high on the balance - reduce to a lower setting
2: Contaminated tungsten	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Touching tungsten into the weld pool	Keep tungsten from contacting weld puddle. Raise the torch so that the tungsten is off of the work piece 2 - 5mm
Touching the filler wire to the tungsten	Keep the filler wire from touching the tungsten during welding, feed the filler wire into the leading edge of the weld pool in front of the tungsten
Tungsten melting into the weld pool	Check that correct type of tungsten is being used. Too much current for the tungsten size so reduce the amps or change to a larger tungsten
3: Porosity - poor weld appearance and colour	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Incorrect Gas	Check that pure Argon is being used
Inadequate gas flow / gas leaks	Check the gas is connected, check hoses, gas valve and torch are not restricted. Set the gas flow between 10 - 15 l/min flow rate. Check hoses and fittings for holes, leaks etc.,
Moisture on the base metal	Remove all moisture from base metal before welding
Contaminated base metal	Remove materials like paint, grease, oil, and dirt, including mill scale from base metal
Contaminated filler wire	Remove all grease, oil, or moisture from filler metal.
Incorrect filler wire	Check the filler wire and change if necessary
4: Yellowish residue / smoke on the alumina nozzle & discoloured tungsten	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Incorrect Gas	Use pure Argon gas
Inadequate gas flow	Set the gas flow between 10 - 15 l/min flow rate
Inadequate post flow gas	Increase the post flow gas time
Alumina gas nozzle too small for size of tungsten being used	Increase the size of the alumina gas nozzle
5: Unstable Arc during DC welding	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Torch connected to DC +	Connect the torch to the DC- output terminal
Contaminated base metal	Remove materials like paint, grease, oil, and dirt, including mill scale from base metal.
Tungsten is contaminated	Remove 10mm of contaminated tungsten and re grind the tungsten
Arc length too long	Lower torch so that the tungsten is off of the work piece 2 - 5mm
Unstable Arc during AC welding	
Incorrect gas or inadequate gas flow	Check that pure Argon is being used. Check the gas is connected, check hoses, gas valve and torch are not restricted. Set the gas flow between 10 - 15 l/min flow rate
Incorrect tungsten being used	Check and change the tungsten type if necessary
Tungsten is contaminated	Remove 10mm of contaminated tungsten and re grind the tungsten
Improperly prepared tungsten	Use a pointed tungsten with AC Squarewave inverter machines. The point will round off after welding.
Excessive rectification in the base metal	Increase balance control. Increase travel speed. Add filler wire during welding

6: HF present but no welding power	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Incomplete welding circuit	Check earth lead is connected. Check all cable connections. If using a water cooled torch check that the power cable is not separated.
No gas	Check the gas is connected and cylinder valve open, check hoses, gas valve and torch are not restricted. Set the gas flow between 10 - 15 l/min flow rate
Tungsten melting into the weld pool	Check that correct type of tungsten is being used. Too much current for the tungsten size so reduce the amps or change to a larger tungsten
7: Arc wanders during DC welding	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Poor gas flow	Check and set the gas flow between 10 - 15 l/min flow rate
Incorrect arc length	Lower torch so that the tungsten is off of the work piece 2 - 5mm
Tungsten incorrect or in poor condition	Check that correct type of tungsten is being used. Remove 10mm from the weld end of the tungsten and re sharpen the tungsten
Poorly prepared tungsten	Grind marks should run lengthwise with tungsten, not circular. Use proper grinding method and wheel.
Contaminated base metal	Remove contaminating materials like paint, grease, oil, and dirt, including mill scale from base metal.
Contaminated filler wire	Remove all grease, oil, or moisture from filler metal.
Incorrect filler wire	Check the filler wire and change if necessary
Arc wanders during AC welding	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Inadequate gas flow	Set the gas flow between 10 - 15 l/min flow rate
Incorrect arc length	Set the torch so that the tungsten is off of the work piece 2 - 5mm
Tungsten is contaminated	Remove 10mm of contaminated tungsten and re grind the tungsten. Use a pointed tungsten with AC Squarewave and inverter machines. The point will round off after welding
Incorrect tungsten size and or tungsten being used	Check and change the size and or the tungsten if required
Excessive rectification in the base metal	Increase balance control. Increase travel speed. Add filler wire during welding
Contaminated base metal	Remove contaminating materials like paint, grease, oil, and dirt, including mill scale from base metal.
8: Arc difficult to start or will not start DC welding	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Incorrect machine set up	Check machine set up is correct
No gas, incorrect gas flow	Check the gas is connected and cylinder valve open, check hoses, gas valve and torch are not restricted. Set the gas flow between 10 - 15 l/min flow rate
Tungsten is contaminated	Remove 10mm of contaminated tungsten and re grind the tungsten
Incorrect tungsten size and or tungsten being used	Check and change the size and or the tungsten if required
Loose connection	Check all connectors and tighten
Earth clamp not connected to work	Connect the earth clamp directly to the work piece wherever possible
Loss of high frequency	Check torch and cables for cracked insulation or bad connections. Check spark gaps and adjust if necessary
Arc difficult to start or will not start AC welding	
<i>Possible Reason</i>	<i>Suggested Remedy</i>
Incorrect machine set up	Check machine set up is correct
No gas, incorrect gas flow	Check the gas is connected and cylinder valve open, check hoses, gas valve and torch are not restricted. Set the gas flow between 10 - 15 l/min flow rate
Incorrect tungsten size and or tungsten being used	Check and change the size and or the tungsten if required
Tungsten is contaminated	Remove 10mm of contaminated tungsten and re grind the tungsten. Use a pointed tungsten with AC Squarewave and inverter machines. The point will round off after welding
Loose connection	Check all connectors and tighten
Earth clamp not connected to work	Connect the earth clamp directly to the work piece wherever possible
Loss of high frequency	Check torch and cables for cracked insulation or bad connections. Check spark gaps and adjust if necessary

SR26 ERGO TIG TORCH

200A AIR COOLED TIG WELDING TORCH

Rating: 200Amp DC, 140Amp AC @35% duty cycle.

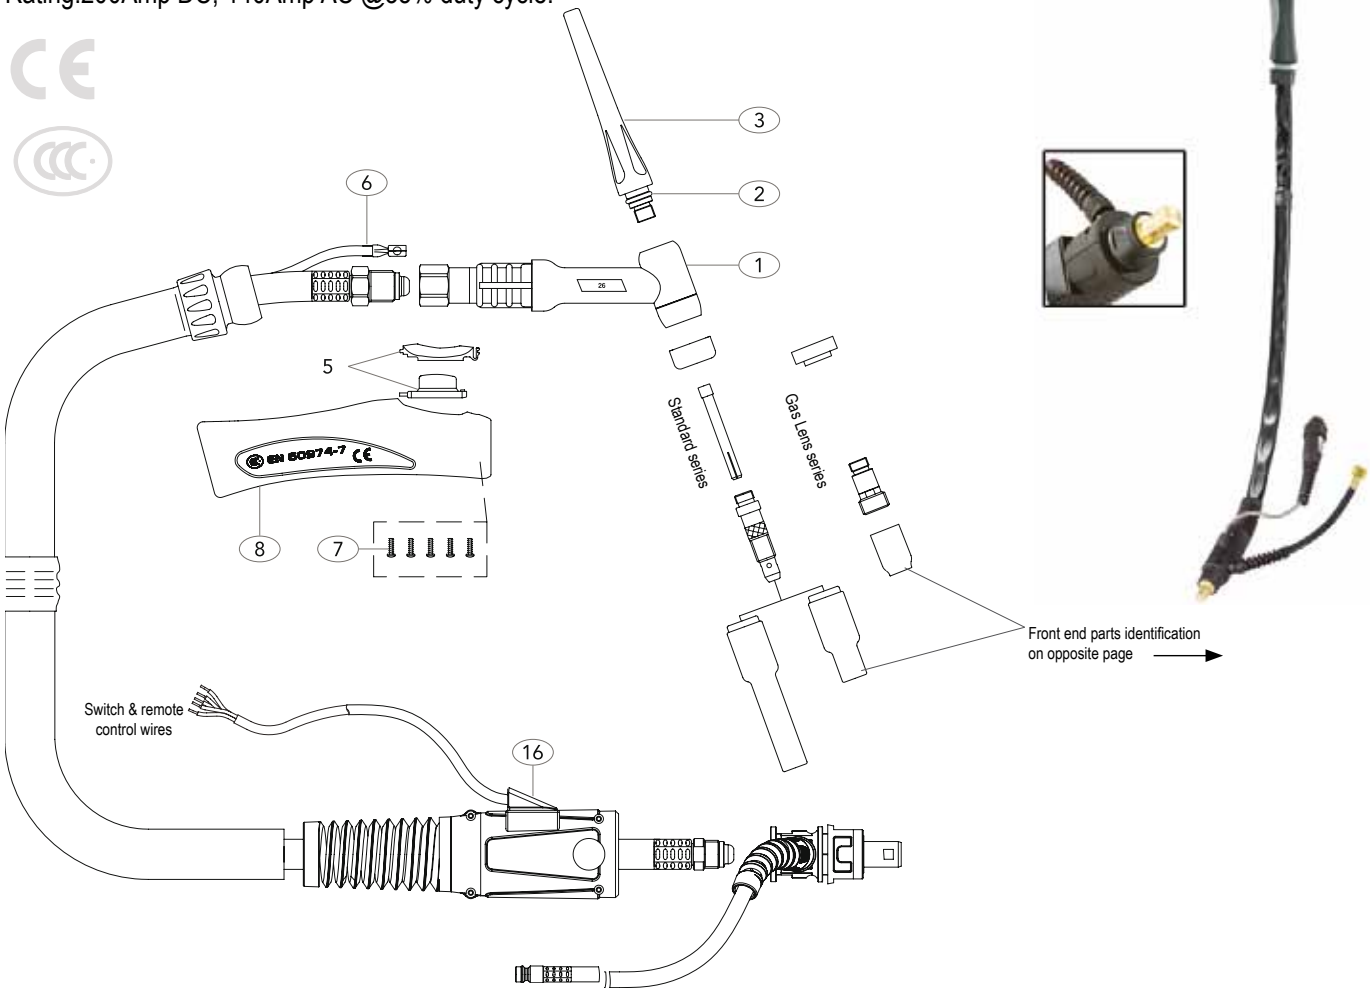






Torch Model			
Description	Part Number		
	4m	8m	
SR26 Suregrip Tig Torch Package c/w QF Gas Connect	SR-26-4MCP50	SR-26-8MCP50	

Spare Parts		
Part Number	Description	
1	WP26	Torch head
	WP26F	Torch head flexible
	WP18	Torch head water-cooled
3	57Y02	Back cap long
3a	57Y03	Medium back cap
3b	57Y04	Short back cap
8	HWP17	Torch handle

SR26 ERGO TIG TORCH

Standard Front End Parts

Part # 18CG	Description Cup Gasket	Part # 10N30 10N31 10N32 10N28	Description Collet Body 1.0mm Collet Body 1.6mm Collet Body 2.4mm Collet Body 3.2mm	Part # 10N49L 53N48L 53N47L	Description Long Alumina Nozzle Ø 8mm #5L Long Alumina Nozzle Ø 10mm #6L Long Alumina Nozzle Ø 11mm #7L
					
	Part # 10N22 10N23 10N24 10N25	Description Collet 1.0mm Collet 1.6mm Collet 2.4mm Collet 3.2mm	Part # 10N50 10N49 10N48 10N47 10N46 10N45 10N44	Description Alumina Nozzle Ø 6mm #4 Alumina Nozzle Ø 8mm #5 Alumina Nozzle Ø 10mm #6 Alumina Nozzle Ø 11mm #7 Alumina Nozzle Ø 13mm #8 Alumina Nozzle Ø 16mm #10 Alumina Nozzle Ø 19mm #12	

Compact Gas Lens Front End Parts

Part # 54N01	Description Gas Lens Gasket	Part # 45V25 45V26 45V27	Description Gas Lens Body 1.6mm Gas Lens Body 2.4mm Gas Lens Body 3.2mm	Part # 54N14 54N15 54N17	Description Gas lens ceramic 8.0mm Gas lens ceramic 7.0mm Gas lens ceramic 5.0mm
					

TR0004-16



RED
ANSI/AWS A5.12-98
ISO 6848 WT20

2% Thoriated: Best stability at medium currents, good arc starts, medium tendency to spit, medium erosion rate.
Commonly used for steel and stainless steel applications

1/16 x 7" (1.6mm x 175mm)
3/32 x 7" (2.4mm x 175mm)
1/8 x 7" (3.2mm x 175mm)

Part #	Description
TR0004-10	1.0mm x 175mm thoriated tungsten electrode 2%
TR0004-16	1.6mm x 175mm thoriated tungsten electrode 2%
TR0004-24	2.4mm x 175mm thoriated tungsten electrode 2%
TR0004-32	3.2mm x 175mm thoriated tungsten electrode 2%

TR0006-16





WHITE
ANSI/AWS A5.12 M-98
ISO 6848 WZ8

.8% Zirconiated: Balls well, handles higher current with less spitting, better arc starts and arc stability than pure tungsten
Commonly used for aluminium applications

1/16 x 7" (1.6mm x 175mm)
3/32 x 7" (2.4mm x 175mm)
1/8 x 7" (3.2mm x 175mm)

Part #	Description
TR0006-10	1.0mm x 175mm zirconiated tungsten electrode 1%
TR0006-16	1.6mm x 175mm zirconiated tungsten electrode 1%
TR0006-24	2.4mm x 175mm zirconiated tungsten electrode 1%
TR0006-32	3.2mm x 175mm zirconiated tungsten electrode 1%

Spare Parts Identification

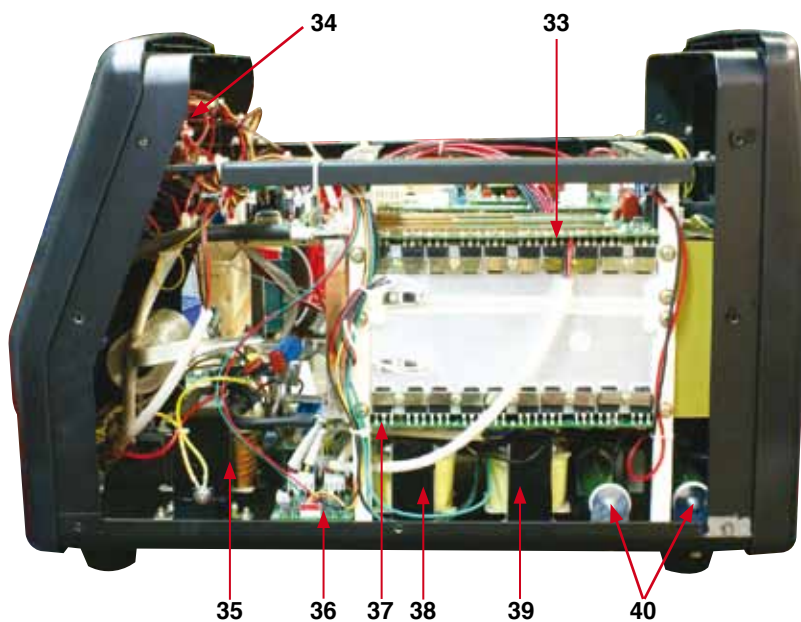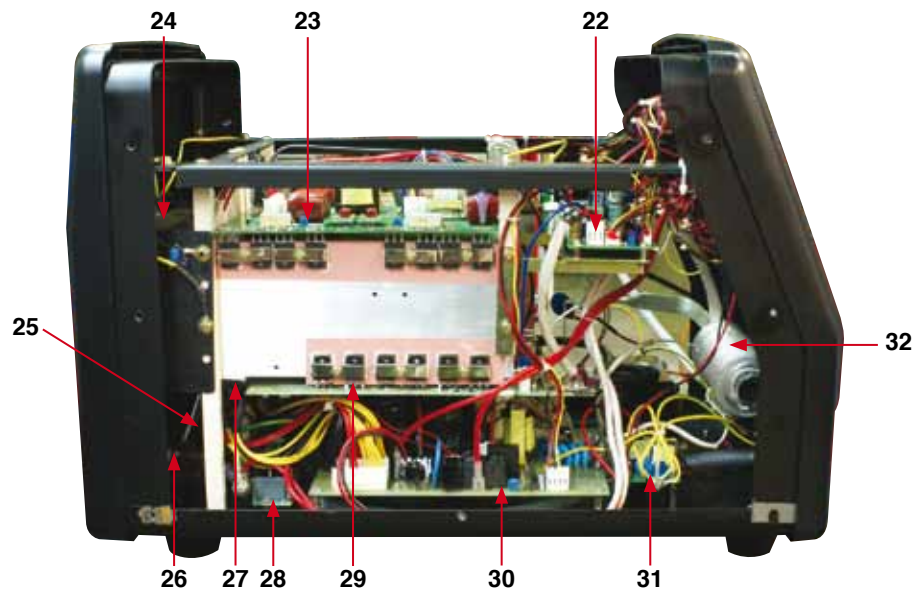

Spare Parts Identification

Part Number	Description
1	J10A10 Front Plastic Panel
2	D20006 Digital Display Meter
3	C16017 On/Off Switch
4	B22310 Remote Control Selector Switch
5	B22329 2T/4T Trigger Selector Switch
6	B22311 Tig/MMA Selector Switch
7	B22330 AC/DC Selector Switch
8	B22328 Pulse Mode Selector Switch
9	C02066 Panel Socket 35-50
10	J24011 Rubber Foot
11	J21009 Gas Connector Quick Fit - Female Panel Mount
12	C04022 2 Pin Connector - Female Panel Mount
13	C04023 5 Pin Connector - Female Panel Mount
14	C04045 7 Pin Connector - Female Panel Mount
15	C14021 Knob
16	P00706 Front Panel Adhesive Sticker
17	C02066 Panel Socket 35-50
18	J24020 Handle
19	J06260 Rear Plastic Panel
20	C13010 Cable Support Assembly
21	J21050 Gas Connector Quick Fit - Female Panel Mount
22	B04045 Low Voltage - Long Strip PCB
23	B01160 Top PCB
24	D28078 Fan
25	B06051 Power Transfer PCB
26	B10361 Gas Solenoid
27	B08003-1 Bridge Rectifier
28	B06036 Protection (EMC) PCB
29	B02044 Middle PCB
30	B03308 Bottom PCB
31	B06197 ACDC Series Hand Switch PCB
32	B17011 Arc Strike Coil
33	B16060 ACDC200P Secondary Inverter PCB (B)
34	B04290 Control PCB
35	D16212 Reactor
36	B05003 AC Driver PCB
37	B16061 ACDC200P Secondary Inverter PCB (A)
38	D03955 Transformer
39	B07010 Industrial Frequency Transformer
40	D01532 Glaze Resistor

Welding Guns Of Australia Pty Ltd

WARRANTY CARD

Welding Guns Of Australia Pty Ltd ('Us', 'We') warrants that the following products under UNI-MIG, UNI-TIG, UNI-PLAS, UNI-FLAME, XCEL-ARC, TECNA, T&R, HIT-8SS & ROTA, supplied by Us and purchased by you from an Authorised UNI-MIG, UNI-TIG, UNI-PLAS, UNI-FLAME, XCEL-ARC, TECNA, T&R, HIT-8SS & ROTA Dealer throughout Australia are free of Material and Faulty Workmanship defects except for those products listed under 'Warranty Exclusions'. These terms and conditions supersede and exclude all former and other representations and arrangements relating to any warranties on these products.

WARRANTY PERIOD

We offer the following 'Warranty Periods' from 'date of purchase':

An Extended Warranty Period of 6 months total shall apply only to Machinery where offered and warranty is registered online.

UNI-MIG DIY Series (Power Source Only)	2 Years	(Clause 3)
UNI-MIG Procraft Series (Power Source Only)	3 Years	(Clause 1&3)
UNI-MIG Trade Series (Power Source Only)	3 Years	(Clause 1&3)
UNI-MIG Trade Series SWF (Power Source / Separate Wire Feeder Only)	3 Years	(Clause 1&3)
UNI-MIG Workshop Series (Power Source Only)	3 Years	(Clause 1&3)
UNI-MIG Workshop Series SWF (Power Source / Separate Wire Feeder Only)	3 Years	(Clause 1&3)
UNI-MIG Jasic DC MMA/TIG (Power Source Only)	3 Years	(Clause 3)
UNI-MIG Jasic Inverter MIG (Power Source Only)	2 Years	(Clause 3)
UNI-MIG Jasic Inverter MIG SWF (Power Source / Separate Wire Feeder Only)	2 Years	(Clause 3)
UNI-TIG Jasic Inverter TIG (Power Source Only)	2 Years	(Clause 3)
UNI-MIG Water Cooler	1 Year	(Clause 3)
T&R Pulse MIG (Power Source Only)	2 Year	(Clause 3)
T&R Pulse MIG SWF (Power Source / Separate Wire Feeder Only)	2 Year	(Clause 3)
UNI-PLAS (Power Source Only)	3 Years	(Clause 3)
UNI-PLAS Jasic Series (Power Source Only)	2 Years	(Clause 3)
UNI-PLAS Site Cut Series (Power Source Only)	1 Year	(Clause 3)
UNI-FLAME Gas Cutting and Welding Kits	3 Months	(Clause 2&3)
UNI-FLAME Straight Line & Gas Cutting Machines (Power Source Only)	1 Year	(Clause 3)
UNI-FLAME Regulators Argon/ Acetylene / Oxygen / LPG / Bobbin Flowmeter	1 Year	
UNI-FLAME Automatic Welding Helmet	2 Years	
UNI-MIG Automatic Welding Helmets	2 Years	
TECNA (Power Source Only)	1 Year	(Clause 3)
HIT-8SS Automatic Carriage (Power Source Only)	1 Year	(Clause 3)
ROTA 102 Rotating table	1 Year	
HOTBOX ElectrodeOven	1 Year	
SPOTCAR 3500	1 Year	(Clause 3)
TORCHES -GMAW, GTAW, MMAW, PLASMA, EARTH LEADS, INTERCONNECTING CABLES, GAS HOSE	3 Months	(Clause 3)

(Clause 1) 3 year warranty on transformers, inductor and rectifier. 1 year warranty on PCB, and all other components.

(Clause 2) Gas Hose, Flashbacks are subject to and covered by the Manufacturer's Individual Warranty, Contact the manufacturer for details.

(Clause 3) This only Covers Manufactures defaults on all accesories for the first three months after date of purchase.

MAKING A CLAIM

If you wish to make a claim under this Warranty, you should:

- Return the product to the point of purchase either in person or on a prepaid courier; or
- Contact Us by Telephone on 02 9870 4200 or Mail PO Box 3033 Lansvale NSW 2166.

When returned, the product must be accompanied with the original invoice including the purchase price and disclosing the purchase date

All costs of installation, cartage, freight, travelling expenses, hiring tools and insurance are paid by the Customer.

To the extent permitted by law, our total liability for loss or damage of every kind related to the product in any way whatsoever is limited to the amount paid to the retailer by you for the product or the value of the product.

WARRANTY / RETURNS / EXCHANGES

1. Subject to the conditions of warranty set out in warranty period, Welding Guns Of Australia PTY LTD warrants that if any defect in any workmanship of Welding Guns Of Australia PTY LTD becomes apparent and is reported to Welding Guns Of Australia PTY LTD within warranty period of the date of delivery (time being of the essence) then Welding Guns Of Australia PTY LTD will either (at Welding Guns Of Australia PTY LTD sole discretion) repair the defect or replace the workmanship.

2. The conditions applicable to the warranty given in warranty period are:

(a) the warranty applies on the basis of the Goods being used on the equivalent of a single daily eight (8) hour shift.

(b) the warranty shall not cover any defect or damage which may be caused or partly caused by or arise through:

(i) failure on the part of the Buyer to properly maintain any Goods
or

(ii) failure on the part of the Buyer to follow any instructions or guidelines provided by Welding Guns Of Australia PTY LTD
or

(iii) any use of any Goods otherwise than for any application specified on a quote or order form
or

(iv) the continued use of any Goods after any defect becomes apparent or would have become apparent to a reasonably prudent operator or user
or

(v) fair wear and tear of the Goods or any part thereof including but not limited to items listed in warranty exclusions.
or

(vi) misuse, neglect, accident, vandalism, damage in transit or any act of God.

(c) the warranty shall cease and Welding Guns Of Australia PTY LTD shall thereafter in no circumstances be liable under the terms of the warranty if the workmanship is repaired, altered or overhauled without Welding Guns Of Australia PTY LTD consent.

(d) in respect of all claims Welding Guns Of Australia PTY LTD shall not be liable to compensate the Buyer for any delay in either replacing or remedying the workmanship or in properly assessing the Buyer's claim.

3. For Goods not manufactured by Welding Guns Of Australia PTY LTD, the warranty shall be the current warranty provided by the manufacturer of the Goods. Welding Guns Of Australia PTY LTD shall not be bound by nor be responsible for any term, condition, representation or warranty other than that which is given by the manufacturer of the Goods.

WARRANTY / RETURNS / EXCHANGES

We understand that sometimes you may need to return a product you have purchased from Welding Guns Of Australia PTY LTD Authorised Dealer Network, to assist you, we have set out below the Welding Guns Of Australia PTY LTD Returns Policy that you should know. Our Returns Policy includes the rights you have under the Australian Consumer Law and other relevant laws. Your Rights under the Australian Consumer Law - Our goods come with guarantees that cannot be excluded under the Australian Consumer Law. You are entitled to a replacement or refund for a major failure and for compensation for any other reasonably foreseeable loss or damage. You are also entitled to have the goods repaired or replaced if the goods fail to be of acceptable quality and the failure does not amount to a major failure.

- You shall inspect the Goods on delivery and shall within seven (7) days of delivery (time being of the essence) notify Welding Guns Of Australia PTY LTD of any alleged defect, shortage in quantity, damage or failure to comply with the description or quote.
- You shall also afford Welding Guns Of Australia PTY LTD the opportunity to inspect the Goods within a reasonable time following delivery if you believe the Goods are defective in any way.
- If you shall fail to comply with these provisions the Goods shall be presumed to be free from any defect or damage. For defective Goods, which Welding Guns Of Australia PTY LTD has agreed in writing that you are entitled to reject, Welding Guns Of Australia PTY LTD liability is limited to either (at the Welding Guns Of Australia PTY LTD discretion) replacing the Goods or repairing the Goods except where you have acquired Goods as a consumer within the meaning of the Trade Practices Act 1974 or the Fair Trading Acts of the relevant state or territories of Australia, and is therefore also entitled to, at the consumer's discretion either a refund of the purchase price of the Goods, or repair of the Goods, or replacement of the Goods.

Returns will only be accepted provided that:

- (a) You have complied with the provisions outlined above, and
 - (b) where the Goods are unable to be repaired, the Goods are returned at your cost within thirty (30) days of the delivery date, and
 - (c) Welding Guns Of Australia PTY LTD will not be liable for Goods which have not been stored or used in a proper manner, and
 - (d) the Goods are returned in the condition in which they were delivered and with all packaging material, brochures and instruction material in as new condition as is reasonably possible in the circumstances.
- Welding Guns Of Australia PTY LTD Accepts no responsibility for products lost, damaged or mislaid whilst in transit
 - Welding Guns Of Australia PTY LTD may (at their sole discretion) accept the return of Goods for credit but this may incur a handling fee of up to fifteen percent (15%) of the value of the returned Goods plus any freight costs.
 - Where a failure does not amount to a major failure, Welding Guns Of Australia PTY LTD is entitled to choose between providing you with a repair, replacement or other suitable remedy.
 - Your rights under the Australian Consumer Law are not limited by a defined time. However, the Australian Consumer Law does recognise that the relevant time period can vary from product to product, depending on factors such as the nature of the product and the price. Welding Guns Of Australia PTY LTD adopts the same approach. As you can appreciate, the type of remedy we can offer you may also vary depending on how long it takes you to return the product to us.

WARRANTY EXCLUSIONS

This Warranty covers Material and Faulty Workmanship defects only. This Warranty does not cover damage caused by:

- Normal wear and tear due to usage
- Misuse or abusive use of the UNI-MIG, UNI-TIG, UNI-PLAS, UNI-FLAME, XCEL-ARC, TECNA, T&R, HIT-8SS & ROTA, instructions supplied with the product.
- Failure to clean or improper cleaning of the product
- Failure to maintain the equipment such as regular services etc
- Incorrect voltage or non-authorized electrical connections
- Improper installation
- Use of non-authorized/non-standard parts
- Abnormal product performance caused by any ancillary equipment interference or other external factors
- Failure or any breakage caused by overload, dropping or abusive treatment or use by the customer
- Repair, modifications or other work carried out on the product other than by an Authorised UNI-MIG, UNI-TIG, UNI-PLAS, UNI-FLAME, XCEL-ARC, TECNA, T&R, HIT-8SS & ROTA Service Dealer Unless it is a manufacturing fault, this Warranty does not cover the following parts:

MIG Welding Torches and Consumables to suit, such as:

Gas Nozzles, Gas Diffusers, Contact Tip holder, Contact tip, Swan Necks, Trigger, Handle, Liners, Wire Guide, Drive Roller, Gas Nozzle Spring, Neck Spring, Connector Block, Insulator, Gas Nipple, Cap, Euro Block, Head Assembly, Gas Block, Trigger Spring, Spring Cable Support, Neck Insulator, Shroud Spring, Gun Plug Cover, Lock Nut, Snap On Head, Spring Cap, Ball, Motor 42 Volt, Pot 10K standard, Knob, Drive Roll Seat, Washer, Bow, Ball Bearing, Wire Conduit Nipple, Central Plug, Printed Circuit Board, Gun Plug House, Cable Support, Gas Connector, Handle To Suit PP36 with Knobs, All Xcel-Arc/ Magmaweld Mig Welding Wires & Electrodes, Arc Leads, Welding Cable, Electrode Holder, Earth Clamps.

TIG Welding Torches and Consumables to suit, such as:

Tungsten Electrodes, Collet, Collet Body, Alumina Nozzle, Torch Head, Torch Head water Cooled, Torch Head Flexible, Back Caps, Gas Lens, Torch Handle, Cup Gasket, Torch Body Gas Valve, O-ring, All UNI-MIG TIG Welding Rods, All Xcel-Arc/ Magmaweld Electrodes, Arc Leads, Welding Cable, Electrode Holder, Earth Clamps.

PLASMA Cutting Torches and Consumables to suit, such as:

All Cutting Tips, All Diffuser/Swirl Ring, All Electrode, Retaining Caps, Nozzle Springs, All Spacers, All Shield Caps, All Air and Power Cables, All Switches, All O-rings, All Springs, All Circle Guides and Cutting Kits, Torch Bodies, Air Filter Regulator, Arc Leads, Welding Cable, Electrode Holder, Earth Clamps

STRAIGHT LINE CUTTING MACHINES and Consumables to suit, such as:

Hoses, Fittings, Track, Cutting Nozzles, Torch

HIT-8SS Welding Carriage Consumables to suit, such as:

Input Cable, Inter-connecting Cable, Triggering Cable.

This Warranty does not cover products purchased:

- From a non-authorized UNI-MIG, UNI-TIG, UNI-PLAS, UNI-FLAME, XCEL-ARC, TECNA, T&R, HIT-8SS & ROTA Dealer (such as purchases from unauthorised retailers and purchases over the Internet from unauthorised local/international sellers or sites such as EBay)
- At an auction;
- From a private seller

Unless it is a manufacturing fault, this Warranty does not apply to any products sold to Hire Companies.

These conditions may only be varied with the written approval of the Directors of Welding Guns Of Australia PTY LTD

REMEMBER TO RETAIN YOUR ORIGINAL INVOICE FOR PROOF OF PURCHASE.



Welding Guns Of Australia Pty Ltd
ABN: 14 001 804 422

PO Box 3033, Lansvale NSW 2166, AUSTRALIA

112 Christina Rd, Villawood, NSW 2163

Phone: (02) 9780 4200

Fax: (02) 9780 4244

Email: sales@unimig.com.au / Web: www.unimig.com.au